



Service Bulletin

TECHNICAL

Subject: Diagnostic Tip for Malfunction Indicator Lamp Illuminated (MIL), DTC P2635 and/or P018B Set

| Brand: | Model: | Model Year: | | VIN: | | Engine: | Transmission: |
|-----------|----------------|-------------|------|------|----|---------------|---------------|
| | | from | to | from | to | | |
| Cadillac | XT5 | 2017 | 2017 | | | LGX | |
| Chevrolet | Colorado | 2016 | 2017 | | | LWN | |
| | Malibu (VIN Z) | 2016 | 2016 | | | LCV | |
| | Malibu | 2017 | 2017 | | | LFV, LTG, LKN | |
| | Volt | 2016 | 2017 | | | L3A | |
| GMC | Canyon | 2016 | 2017 | | | LWN | |
| | Acadia | 2017 | 2017 | | | LCV, LGX | |

| | |
|-----------------------------------|---|
| Involved Region or Country | North America and all N.A. Export Regions |
| Condition | <p>Some customers may comment that the Malfunction Indicator Light (MIL) is illuminated. The Technician may find one or more of the following DTCs set:</p> <ul style="list-style-type: none"> • P2635 • P018B <p>Some customers may also comment on one or more of the following symptoms:</p> <ul style="list-style-type: none"> • Hesitation • Surging • Stalling |
| Cause | This condition may be caused by a loss of retention resulting in leakage between the fuel pump and upper manifold assembly. |

Correction

If the DTC P2635 and/or P018B code set, replace the fuel pump module.

Service Procedure

Install fuel pump module. Refer to *Fuel Tank Fuel Pump Module Replacement* in SI.

Parts Information

| Model | Description | RPO | Part Number | Qty |
|-----------------|-------------------------|------------------------|-------------|-----|
| Malibu | Module Kit, F/TNK F/PMP | LTG, LKN | 23406970 | 1 |
| Malibu | Module Kit, F/TNK F/PMP | LFV | 23406971 | 1 |
| 2016 Malibu | Module Kit, F/TNK F/PMP | LCV | 84100549 | 1 |
| Acadia/XT5 | Module Kit, F/TNK F/PMP | LCV, LGX (Without F48) | 84074259 | 1 |
| Acadia/XT5 | Module Kit, F/TNK F/PMP | LCV, LGX (With F48) | 23379152 | 1 |
| Colorado/Canyon | Module Kit, F/TNK F/PMP | LWN | 23333574 | 1 |
| Volt | Module Kit, F/TNK F/PMP | L3A | 23375543 | 1 |

Warranty Information

| Labor Operation | Description | Labor Time |
|-----------------|--|------------------------------------|
| 4028730 | Fuel Tank Fuel Pump Module Replacement | Use Published Labor Operation Time |

| | |
|-----------------|--|
| Version | 3 |
| Modified | August 16, 2016 - Updating the Warranty Information. Nov. 7, 2016 - Added new Models, RPOs and Parts Information. |

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION