



**NUMBER:** 09-007-16

**GROUP:** Engine

**DATE:** June 01, 2016

*This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.*

**THIS SERVICE BULLETIN IS ALSO BEING RELEASED AS RAPID RESPONSE TRANSMITTAL (RRT) 16-047. ALL APPLICABLE SOLD AND UN-SOLD RRT VIN'S HAVE BEEN LOADED. TO VERIFY THAT THIS RRT SERVICE ACTION IS APPLICABLE TO THE VEHICLE, USE VIP OR PERFORM A VIN SEARCH IN TECHCONNECT. ALL REPAIRS ARE REIMBURSABLE WITHIN THE PROVISIONS OF WARRANTY.**

***SUBJECT:***

Tighten Generator Mounting Bolts

***OVERVIEW:***

This bulletin involves torquing the generator mounting bolts to proper specifications.

***MODELS:***

|      |      |                  |
|------|------|------------------|
| 2016 | (LD) | Dodge Charger    |
| 2016 | (LA) | Dodge Challenger |
| 2016 | (LX) | Chrysler 300     |

**NOTE: This bulletin applies to vehicles within the following markets: NAFTA, APAC, EMEA and LATAM.**

**NOTE: This bulletin applies to vehicles built on or after April 05, 2016 (MDH 0405XX) and on or before April 06, 2016 (MDH 0406X) equipped with one of the following:**

- 5.7L V8 Hemi MDS VVT Engine (Sales Code EZH)
- 5.7L V8 Hemi VVT Engine (Sales Code EZC)
- 6.2L V8 Supercharged Engine (Sales Code ESD)
- 6.4L V8 SRT Hemi MDS Engine (Sales Code ESG)
- 6.4L V8 SRT Hemi Engine (Sales Code ESH)

***SYMPTOM/CONDITION:***


The customer may hear a noise coming from the generator or possibly experience loss of charging.

***DIAGNOSIS:***

If a customer's VIN is listed in VIP or your RRT VIN list, perform the repair. For all other customers that describe the symptom/condition listed above, perform normal diagnostics.

**REPAIR PROCEDURE:**

1. Raise and support the vehicle. Refer to the detailed service procedures available in DealerCONNECT> TechCONNECT under: Service Info>04 - Vehicle Quick Reference/Hoisting/Standard Procedure>Standard Procedure - Hoisting.
2. Tighten all three generator mounting bolts to 54 N·m (40 ft. lbs.) (Fig. 1).

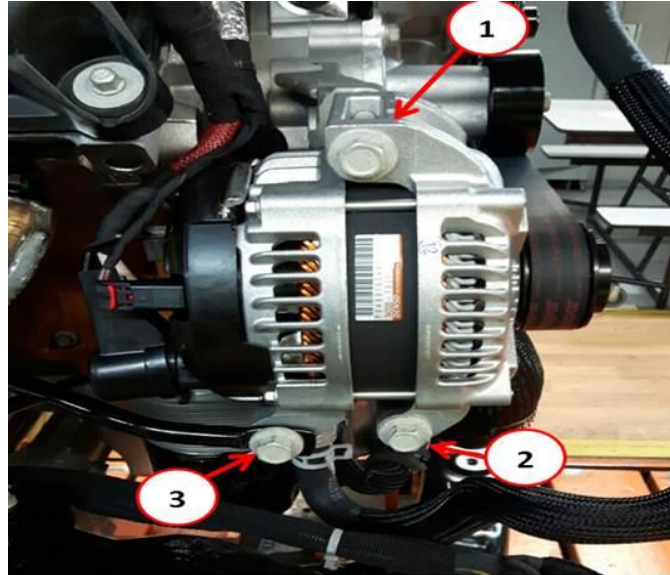

**Fig. 1 Generator Mounting Bolts**

- 1 - Upper Mounting Bolt
- 2- Outer Mounting Bolt Towards The Belt
- 3- Inner Mounting Bolt Towards The Engine

3. Lower the vehicle. Refer to the detailed service procedures available in DealerCONNECT> TechCONNECT under: Service Info>04 - Vehicle Quick Reference/Hoisting/Standard Procedure>Standard Procedure - Hoisting.

**POLICY:**

Reimbursable within the provisions of the warranty.

**TIME ALLOWANCE:**

| Labor Operation No: | Description   | Skill Category                    | Amount   |
|---------------------|---|-----------------------------------|----------|
| 08-05-01-92         | Generator - Bolts, Tighten (LX/LD 5.7L - 6.4L) (1 - Semi Skilled) | 1 - Engine Repair and Performance | 1.0 Hrs. |
| 08-05-01-93         | Generator - Bolts, Tighten (LA 5.7L - 6.4L) (1 - Semi Skilled)    | 1 - Engine Repair and Performance | 1.2 Hrs. |
| 08-05-01-94         | Generator - Bolts, Tighten (LA/LD 6.2L) (1 - Semi Skilled)        | 1 - Engine Repair and Performance | 1.4 Hrs. |

**FAILURE CODE:**

|    |                |
|----|----------------|
| ZZ | Service Action |
|----|----------------|