

6/22/16

MY 16, 17

DD, DF, DP

GPOP - Issue Review System

Part Number: RL300150A\$, RL300149A\$, RL300152A\$

Part Description: AS69RC Transmission

Issue Description: For DD, DF, and DP Models ONLY; Code P2757 – TCC PRESSURE CONTROL SOLENOID CONTROL CIRCUIT PERFORMANCE~
Transmission Part Numbers: RL300150AA [4x4], or RL300149AA [4x2 LHS PTO], RL300152AB 4x2 RHS PTO]~

If you are ordering an Aisin Transmission AS69RC [sales code DF2] for replacement due to code P2757 present [for 2016MY only] with the following symptoms:~

1. Code P2757 with MIL on [Check engine light on]~
2. Harness check is good~
3. Vehicle build dates are from 10/15/2015 to 4/17/2016~
4. Low miles - approximately below 1500 miles.~

Suggested repair actions:~

1. Clear the code and test drive with light throttle attempting to engage torque converter lock up. The code P2757 will set, if torque converter lock up fails.~
2. If the code P2757 returns: Replace Torque Converter [Part number RL335702AA] only.~
3. Return the suspect Torque converter to FCA for review. [Follow Part retention process]~

~
Contact Us at CAGRIS@Chrysler.com for feedback related ONLY to this GPOP Tech Tip. DO NOT email regarding repair procedures unrelated to this Tech Tip or part order inquires. Please include the Part Number (s) and Tech Tip Part Description of the Tech Tip you are referencing for our tracking system.
