



WATER LEAKING INTO REAR COMPARTMENT

MODEL

F07 (5 Series Gran Turismo)

F12 (6 Series Convertible)


F13 (6 Series Coupe)

SITUATION

Water is found in rear compartment.

CAUSE

Seal around fuel filler tube (located by red lines) is not effective.

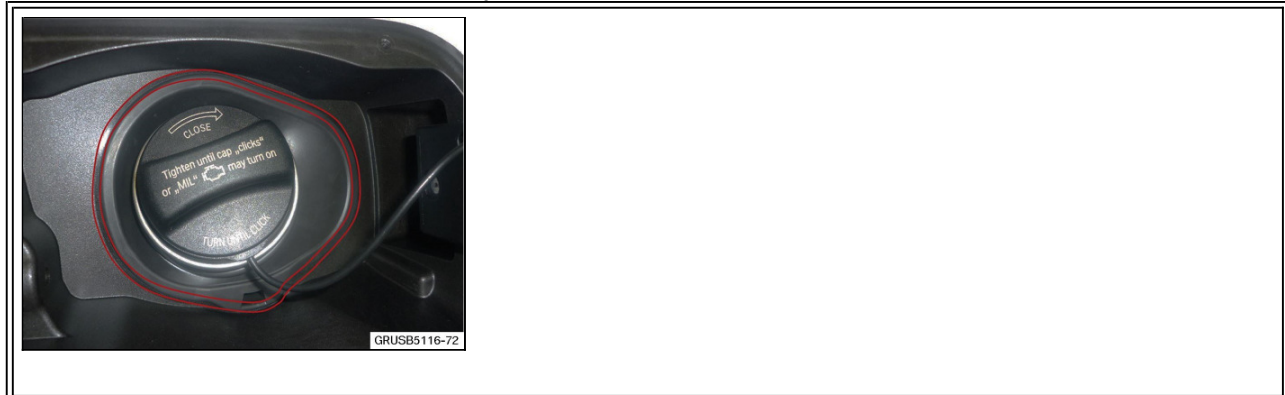

CORRECTION

Replace cover pot (bowl).

PROCEDURE

1. Check for water leaking around fuel filler seal. Examine both outside and inside surfaces.

Is water getting into the rear compartment around the fuel filler seal?

YES- continue to step 2.

NO- contact Technical Support for further assistance.

2. Refer to REP 41 63 003 "Replace Cover Bowl", replace cover bowl.
3. Verify water tightness.

PARTS INFORMATION

Part Number	Description	Quantity
F07		
51 17 7 201 690	Cover pot	1
51 17 7 217 174	Gasket	1
F12/F13		
51 17 7 228 213	Cover pot	1

WARRANTY INFORMATION

Covered under the terms of the BMW New Vehicle Limited Warranty for Passenger Cars and Light Trucks.

Defect Code:	41 63 00 41 00	
Labor Operation:	Labor Allowance:	Description:
41 63 003*	Refer to KSD	Replacing cover pot/bowl

Labor operation code 41 63 003 is a Main labor operation. If you are using a Main labor code for another repair, use the Plus code labor operation 41 63 503 instead.

[Copyright ©2016 BMW of North America, Inc.]