

September 2016
Technical Service

REPLACE KAFAS CAMERA

Please perform the procedure outlined in this Service Information on all affected vehicles before customer delivery. In the event the customer has already taken delivery of the vehicle, please perform the procedure the next time the vehicle is in the shop.

MODEL

F16 (X6)	F86 (X6 M)
Certain vehicles produced from January 9, 2016 to January 30, 2016.	

SITUATION

A CCM (Check Control Message) advising of a front camera malfunction is displayed in the CID when the ambient outside temperature is high.

Some known KAFAS Driver based assistance functions affected:

- Front collision warning
- Pedestrian detection
- Lane Departure Warning

CAUSE

The temperature sensor of the KAFAS camera was calibrated incorrectly causing the built-in over-temperature module protection function to trigger to early.

CORRECTION

Replace the KAFAS camera.

PROCEDURE

Replace the KAFAS camera following **REP 66 51 030** "Removing and installing/replacing the KAFAS camera".

PARTS INFORMATION

Part Number	Description	Quantity
66 51 9 352 750	KAFAS camera	1

WARRANTY INFORMATION

Reimbursement for this Service Action will be via normal claim entry utilizing the following

information:

Defect Code:	00 66 22 01 00	
Labor Operation:	Labor Allowance:	Description:
00 64 682	3 FRU	Replacing the KAFAS camera (Plus work)

[Copyright ©2016 BMW of North America, Inc.]