

August 2016 Technical Service

HEATED SEAT TEMPERATURES INSUFFICIENT

MODEL

| TESS CLOODEL COODELS BAIDION 4 0000 | F56 (Cooper, Cooper S Hardtop 2 door) | |
|---|---------------------------------------|--|
| Production November 1, 2013 through December 10, 2015 | | |

SITUATION

Seat heater output is too low.

CAUSE

Seat heating mat is ineffective

CORRECTION

Replace the upholstery (bottom foam pad) with heating mat

PROCEDURE



Note: As long as the seat heaters generate "80 degrees Fahrenheit or above," the

seat heaters do not require replacement.

• In this case, replacement of the mat does not provide any improvement in seat heater output.

Seat Mat Nominal Values Reference Information

| Variable | Nominal Value |
|---|---------------|
| Voltage range | 9 to 16 V |
| Clocking of the PWM signal | 25Hz |
| Maximum surface temperature at the seat heating pad (shutdown by seat module) | 107.6 F |

For conditions matching situation described, replace the upholstery (bottom foam pad) with heating mat, using the following ISTA repair procedures:

REP 52 13 417 "Replacing upholstery for driver's seat"

Or / and

REP 52 13 418 "Replacing upholstery for front passenger seat"

PARTS INFORMATION

| Part Number | Description | Quantity |
|-----------------|---|----------|
| Refer to ETK | Foam pad with heating mat /driver side | 1 |
| Or/and: | | |
| Refer to ETK | Upholstery pad with heating mat and CIS passenger | 1 |
| 07 14 9 321 690 | Fillister-head screw | 4 or 8 |

WARRANTY INFORMATION

Covered under the terms of the MINI New Passenger Car Limited Warranty or the MINI NEXT Certified Pre-Owned Limited Warranty.

|--|

Basic Seat/Driver's Side

| Labor Operation: | Labor Allowance: | Description: |
|------------------|------------------|--|
| 52 13 417 | Refer to KSD2 | Replacing padding for driver's seat (Main work) |
| Or: | | |
| 52 13 917 | Refer to KSD2 | Replacing padding for driver's seat (Plus work – Vehicle is already in the workshop) |

Or:

Basic Seat/Passenger's Side

| Labor Operation: | Labor Allowance: | Description: |
|------------------|------------------|--|
| 52 13 418 | Refer to KSD2 | Replacing padding for front passenger's seat (Main work) |
| | | |

| Or | |
|-----------|---|
| 52 13 918 | Replacing padding for front passenger's seat (Plus work – Vehicle is already in the workshop) |

Or:

Basic Seat/Both Sides

| Labor Operation: | Labor Allowance: | Description: |
|------------------|------------------|---|
| 52 13 417 | Refer to KSD2 | Replacing padding for driver's seat (Main work) |
| Or: | | |
| 52 13 917 | Refer to KSD2 | Replacing padding for driver's seat (Plus work – Vehicle is already in the workshop) |
| And: | | |
| 52 13 918 | Refer to KSD2 | Replacing padding for front passenger's seat (Plus work – Vehicle is already in the workshop) |

Or, for the:

Sport Seat (Option Code 481)/Driver's Side

| Labor Operation: | Labor Allowance: | Description: |
|------------------|------------------|---|
| 52 13 425 | Refer to KSD2 | Replacing padding for front passenger's seat (Main work) |
| Or: | | |
| 52 13 925 | Refer to KSD2 | Replacing padding for front passenger's seat (Plus work – Vehicle is already in the workshop) |

Sport Seat (Option Code 481)/Passenger's Side

| | | 1 |
|-----|----|----|
| | | 11 |
| | | 11 |
| [1] | 11 | il |

| Labor Operation: | Labor Allowance: | Description: |
|------------------|------------------|---|
| 52 13 426 | Refer to KSD2 | Replacing padding for front passenger's seat (Main work) |
| Or | | |
| 52 13 926 | Refer to KSD2 | Replacing padding for front passenger's seat (Plus work – Vehicle is already in the workshop) |

Or:

Sport Seat (Option Code 481)/Both Sides

| Labor Operation: | Labor Allowance: | Description: |
|------------------|------------------|---|
| 52 13 425 | Refer to KSD2 | Replacing padding for driver's seat (Main work) |
| Or: | | |
| 52 13 925 | Refer to KSD2 | Replacing padding for driver's seat (Plus work – Vehicle is already in the workshop) |
| And: | | |
| 52 13 926 | Refer to KSD2 | Replacing padding for front passenger's seat (Plus work – Vehicle is already in the workshop) |

[Copyright ©2016 BMW of North America, Inc.]