



Water Ingress In Footwell Area From A/C Condensate Drain

This Service Information bulletin supersedes SI M64 01 16 dated March 2016.


New information provided by this update is preceded by this symbol 

MODEL

F54 (Cooper, Cooper S Clubman)	F55 (Cooper, Cooper S Hardtop 4 door)	F56 (Cooper, Cooper S Hardtop 2 door)	F57 (Cooper, Cooper S Convertible)
--------------------------------	---------------------------------------	---------------------------------------	------------------------------------


SITUATION


 Damp front foot-well carpet after long period of air conditioning use.

 Musty odor in the vehicle (moldy, old socks, laundry room).


CAUSE

 The A/C condensate drain hose is blocked by the heatshield.


 The A/C condensate drain hose is not attached properly to the housing.

 The A/C condensate drain hose was damaged during installation or previous repair.



CORRECTION

 Modify the condensate drain hose even though the hose was replaced or had no damage.

Or

 Replace the condensate drain hose if it is damaged or drains slowly and perform the modification.

PROCEDURE

-  Follow repair procedure attached- SI "M640116_Modify_Drain_Hose".
-  Recheck for proper condensate drainage from the vehicle.

3. **UPDATE!** After repair, turn the heat to max for about 15 to 20 mins.

PARTS INFORMATION

UPDATE!

Part Number	Description	Quantity
64 11 9 262 789	Condensate water drain	1 / if needed

WARRANTY INFORMATION

Covered under the terms of the MINI New Passenger Car Limited Warranty

Defect Code:	64 11 33 32 00	
Labor Operation:	Labor Allowance:	Description:
64 99 000	5 FRU's	Work time to check water leak and modify the condensation drain hose
Or:		
64 99 000	6 FRU's	Work time to check water leak, install and modify condensate drain.

Work time labor operation code 64 99 000 is not considered a Main labor operation. Also, since the "work time" FRU allowance to be claimed is specified, a separate punch time is not required.

ATTACHMENTS

View PDF attachment [M640116 Modify Drain Hose.](#)

[Copyright ©2016 BMW of North America, Inc.]