




REVERSE LIGHT SHINES INTO PASSENGER CABIN

MODEL

F48 (X1 sDrive 28i or xDrive 28i)
Produced from February 29, 2016 to August 25, 2016

SITUATION

Reverse light shines into passenger cabin at the rear window and glares into driver's eyes from interior rearview mirror.

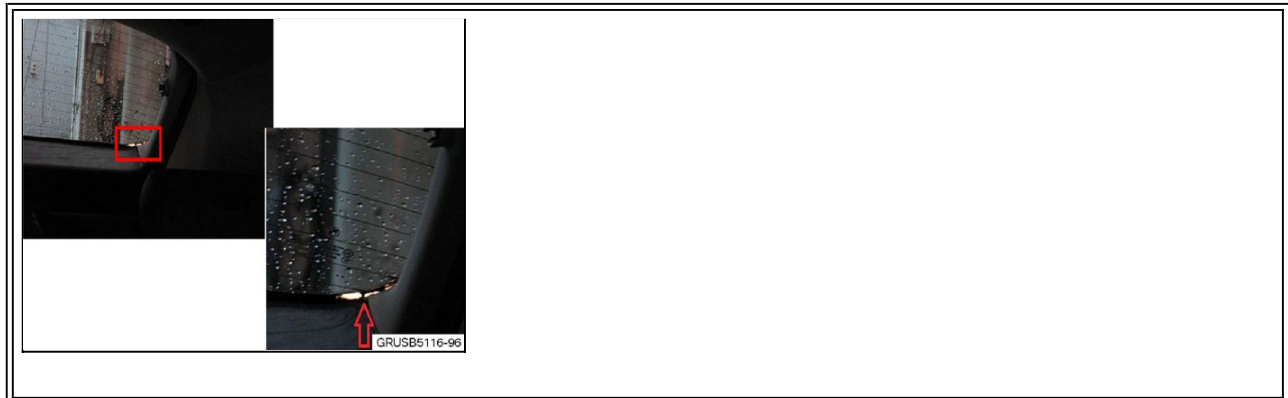

CAUSE

Deletion of light cover.

CORRECTION

Install light covers.

PROCEDURE

For conditions that are similar to the situation described:

1. Remove tailgate trim panel following REP 51 49 000 "Removing and installing/replacing the tailgate trim panel;"
2. Attach the light cover on one side as shown in the attached video; then
3. Attach opposite side cover
4. Re-install the tailgate trim panel

The link for the light panel bulkhead video is here: <http://tinyurl.com/jbud4s2>

PARTS INFORMATION

Part Number	Description	Quantity
51 49 7 425 995	Light cover left	1
51 49 7 425 996	Light cover right	1

WARRANTY INFORMATION

Covered under the terms of the BMW New Vehicle Limited Warranty for Passenger Cars and Light Trucks.

Defect Code:	5149024100	
Labor Operation:	Labor Allowance:	Description:
51 49 000	Refer to KSD	Removing and installing or replacing trim panel for luggage compartment lid (Main work)
And:		
51 99 000	2 FRU	Work time to install the left and right light panel covers (bulkheads).

If you are using a Main labor code for another repair, use the Plus code labor operation 51 49 500 instead.

[Copyright ©2016 BMW of North America, Inc.]