



WIND DEFLECTOR DAMAGED

MODEL

F57 (Cooper, Cooper S Convertible)

SITUATION

A rattle may be heard from the wind deflector while driving or, the retaining pins may be broken when installing wind deflector.

CAUSE

Retaining pins in wind deflector are broken.

CORRECTION


Replace retaining pins.



Note: Complete replacement of the wind deflector for damaged retaining pins is no

longer allowed.

PROCEDURE

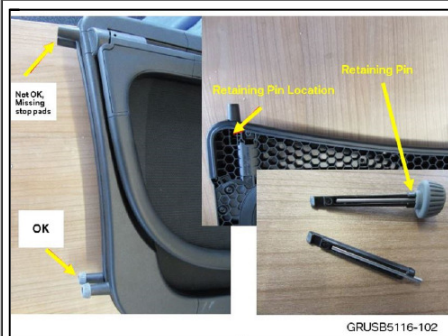

For conditions that are similar to the situation described:

1. Remove broken retaining pins from the wind deflector.
2. Insert new retaining pins. Use part number 54 34 7 488 320 for all replacements.

PARTS INFORMATION

Part Number	Description	Quantity
54 34 7 488 320	Retaining pins	4

WARRANTY INFORMATION

Covered under the terms of the MINI New Passenger Car Limited Warranty as applicable.

Defect Code:	7260525700	
Labor Operation:	Labor Allowance:	Description:
54 99 000	3 FRU	Work time to replace wind deflector pivot pins (Main work)
Or:		
54 99 000	2 FRU	Work time to replace wind deflector pivot pins (Plus work – Vehicle already in the workshop)

[Copyright ©2106 BMW of North America, Inc.]