



NBT-EVO Head Unit Cannot Be Swapped Between Vehicles for Testing

This Service Information bulletin supersedes SI B65 13 16 dated July 2016.

MODEL

F22 2 Series from 3/2015	F23 2 Series convertible from 3/2014	F30 3 Series from 7/2015 F23 2 Series convertible from 3/2014	F31 3 Series touring from 7/2015
F34 3 Series GT from 7/2015	F32 4 Series coupe from 7/2015	F33 4 Series convertible from 7/2015	F36 4 Series GC from 7/2015
F12 6 Series from 3/2016	F13 6 Series from 3/2016	F25 X3 from 4/2016	F26 X4 from 4/2016
F15 X5 from 8/2016	F85 X5 M from 8/2016	F16 X6 from 8/2016	F86 X6 M from 8/2016
G12 7 Series from SOP	Affects vehicles with SA609 - Navigation System Professional (NBT-EVO HU-H2)		

SITUATION

If an NBT-EVO head unit is swapped into a different vehicle it will enter a locked mode once it recognizes a different VIN.



This will set a fault in the Head Unit (NBT-EVO), Fault Code "B7F87A: Burgler Actively Registered / Component Protection Active"

This will require REPLACEMENT of the head unit to restore operation.

CAUSE

To prevent easy re-use of stolen Head units additional features are introduced with 11/15 ISTAP software to bring NBT-EVO to a higher security level.

In NBT-EVO the mechanism is called "Trusted VIN"

CORRECTION

Do not swap NBT-EVO HU-H2 head units between vehicles for testing.

WARRANTY INFORMATION

Not applicable.

[Copyright ©2016 BMW of North America, Inc.]