



SI B52 04 16
Seats

August 2016
Technical Service

NOISE FROM THE FRONT SEAT WHEN ENTERING / EXITING THE VEHICLE

MODEL

F15 (X5)	F16 (X6)	F85 (X5 M)	F86 (X6 M)
----------	----------	------------	------------

SITUATION

The front seats generate a squeaking noise upon entering or exiting the vehicle. The noise may also occur when repositioning on the seat or movement while driving.

CAUSE

Aged/dried leather on the seat bottom cushion rubbing against the plastic side trim.

CORRECTION

Treat the seat leather using approved BMW leather care.

PROCEDURE

	<ul style="list-style-type: none"> • Verified the situation. • Apply BMW leather Care with UV Protection to the area in 'red' between outer-side switch trim holder and leather cushion. • The recommended leather care UV protection part number is 83 19 2 339 687 • Recheck operation after repair.
--	--

WARRANTY INFORMATION

Not applicable.

[Copyright ©2016 BMW of North America, Inc.]