



INSTRUMENT CLUSTER CLOCK LOSES TIME

This Service Information bulletin supersedes SI B62 09 16 **dated May 2016**.

MODEL

G12 (7 Series Sedan Produced from November 1, 2015 to June 29, 2016)
With option code 609 (Navigation System Professional)

SITUATION

The time displayed in the KOMBI (instrument cluster) may lose a few minutes each week

CAUSE

Internal KOMBI calculation error.

CORRECTION

Reprogram KOMBI

PROCEDURE

If the vehicle condition is similar to the situation described:

1. Run diagnostics with ISTA.
2. Program and encode the vehicle with ISTA/P 3.59.1 / S15A-16-07-502 or a more recent version.

Note that ISTA/P will automatically reprogram and code all programmable control modules that do not have the latest software. For information on programming and coding with ISTA/P, refer to CenterNet / TIS / Technical Documentation / Diagnostics and Programming.

Always connect a BMW approved battery charger / power supply ([SI B04 23 10](#)).

WARRANTY INFORMATION

Covered under the terms of the BMW New Vehicle Limited Warranty for Passenger Cars and Light Trucks or the BMW Certified Pre-Owned Program.

Defect Code:	62 13 03 18 00	
Labor Operation:	Labor Allowance:	Description:
00 00 006	Refer to KSD2	Performing "vehicle test" (with vehicle

		diagnosis system – checking faults)
And:		
61 21 528	Refer to KSD2	Connect an approved battery charger/power supply(indicated in KSD2 as “Charging battery”)
And:		
61 00 730	Refer to KSD2	Programming / encoding control unit(s)

If you are using a Main labor code for another repair, use the Plus code labor operation 00 00 556 instead.

Refer to KSD2 for the corresponding flat rate unit (FRU) allowance.

Vehicle Programming and Coding

Control module failures that occur during programming:

- Please claim these consequential repairs under the defect code listed in this bulletin and use the applicable KSD2 labor operations.

Other Repairs

Control module failures that occur prior to programming:

- When covered under an applicable limited warranty, claim these repairs using the applicable defect code and labor operations in KSD2.

[Copyright ©2016 BMW of North America, Inc.]