



SI B61 15 16
General Electrical Systems

July 2016
Technical Service

CCM "CHARGING NO LONGER POSSIBLE" DURING OR AFTER TRANSPORT MODE

MODEL

I01, Produced since 6/30/16

SITUATION

After removing transport mode certain fault codes may be store erroneously. These include 21E633, 222805, and 222834.

CAUSE

Erroneous fault entry from KLE and EME during transport mode

CORRECTION

If these faults are entered ignore the diagnostic instructions. Clear the fault codes and release the vehicle.

PROCEDURE

Note: To clear fault code 222834 drive readiness must be established for minimum 15s before the fault will clear

WARRANTY INFORMATION

Not applicable.

[Copyright ©2016 BMW of North America, Inc.]