



SI B66 15 16  
Distance Systems, Cruise Control, Remote Control

July 2016  
Technical Service

---

**THE SMART OPENING/CLOSING TAILGATE FUNCTION IS INOPERATIVE.**

**MODEL**

F48 (X1) Vehicles with option code 322 (comfort access) Vehicles produced to July 6, 2016
---

**SITUATION**

Vehicles with comfort access and **without** rear trailer tow hitch; the contactless tailgate smart opening/closing function using foot motion is INOPERATIVE.

**CAUSE**


The heat insulation on the rear bumper partially blocks the top and/or bottom sensor signal, which prevents foot movement detection

**CORRECTION**

Remove the heat insulation shield and cut the areas as shown in the picture below.

**PROCEDURE**

---

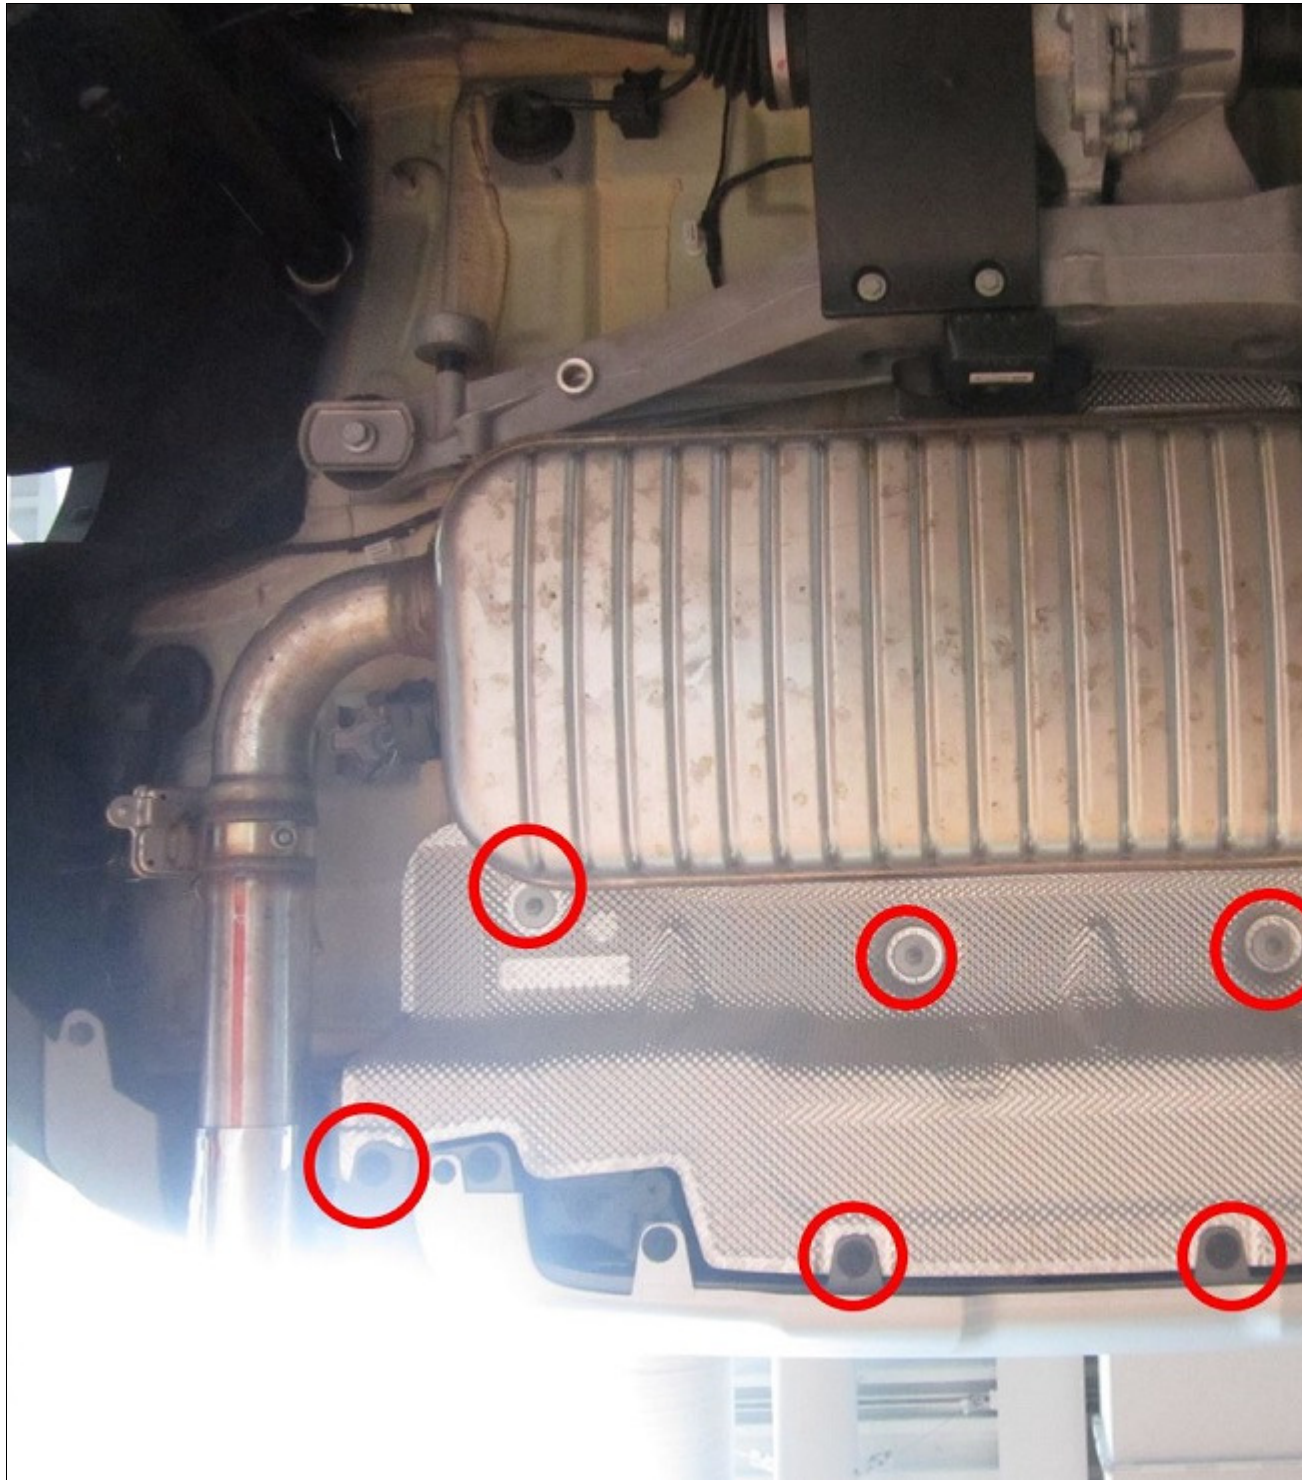



**WARRANTY INFORMATION**

Covered under the terms of the BMW New Vehicle Limited Warranty for Passenger Cars and Light Trucks.

<b>Defect Code:</b>	<b>51 48 12 41 00</b>
---------------------	-----------------------

<b>Labor Operation:</b>	<b>Labor Allowance:</b>	<b>Description:</b>
51 99 000	7 FRU	Work time to remove, modify and reinstall the rear heat shield insulation under the vehicle (Main work)
Or:		
51 99 000	5 FRU	Work time to remove, modify and reinstall the rear heat shield insulation under the vehicle (Plus work – Vehicle already in the workshop)



**Note: Only one (1) Main labor operation can be claimed per repair visit/claim submission.**

[ Copyright ©2016 BMW of North America, Inc. ]