



## SQUEAKING NOISE FROM POWER FOLDING EXTERIOR REARVIEW MIRRORS

### MODEL

F54 (Cooper Clubman / Cooper S Clubman)	F55 (Cooper hardtop 4 door / Cooper S hardtop 4 door)	F56 (Cooper hardtop 2 door / Cooper S hardtop 2 door)	F57 (Cooper Convertible) / Cooper S Convertible)
Vehicles with Option Code 313 Power Folding Mirrors			
Produced to April 18, 2016			

### SITUATION

A squeaking noise can be heard when folding the exterior rear view mirrors in or out.


### CAUSE

Tolerances in the exterior rear view mirrors

### CORRECTION

Apply lubricant to the contact surfaces in the exterior rear view housing.

### PROCEDURE

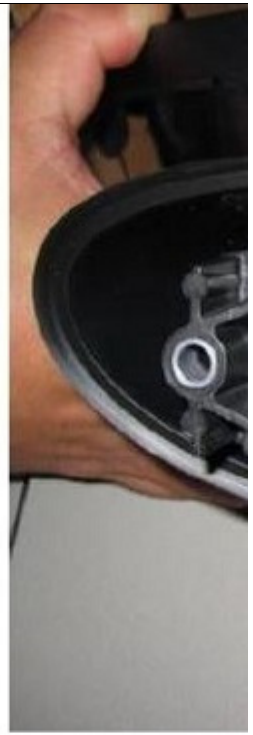

**PARTS INFORMATION**

Part Number	Description	Quantity
83 23 0 309 627	Sliding Agent Carbaflo KSP105	As needed

Please note one container is sufficient to carry out 30 applications. Refer to sublet instructions below.

#### WARRANTY INFORMATION

Covered under the terms of the MINI New Passenger Car Limited Warranty as applicable.

<b>Defect Code:</b>	<b>51 16 00 39</b>	
<b>Labor Operation:</b>	<b>Labor Allowance:</b>	<b>Description:</b>
51 16 020*	Refer to KSD	Removing and installing or replacing mirrors on both front doors (Main work)
And		
51 00 001	2 FRU	Applying lubricant to contact surfaces of one mirror

Labor operation code 51 16 000 is a Main labor operation. If you are using a Main labor code for another repair, use the Plus code labor operation 51 16 500 instead.

#### Sublet – Bulk Materials

<b>Sublet Code 4</b>	See sublet reimbursement calculation below	Reimbursement for the repair-related bulk materials (BMW part number(s), please do not use the part numbers for claim submission)
----------------------	--	---

Sublet reimbursement calculation for claiming the “used quantities” of repair-related bulk materials (BMW part numbers) is at dealer net plus your center’s handling.

**ENTER THIS MATERIAL COST IN SUBLET AND ITEMIZE THE AMOUNT ON THE REPAIR ORDER AND IN CLAIM COMMENT SECTION.**

[ Copyright ©2016 BMW of North America, Inc. ]