



SI M61 01 16
General Electrical Systems

August 2016
Technical Service

Front Windshield Wiper Noises

This Service Information bulletin supersedes SI M61 01 16 **dated April 2016.**

MODEL

F54 (Cooper, Cooper S Clubman)	F55 (Cooper, Cooper S 4 Door Hardtop)	F56 (Cooper, Cooper S 2 Door Hardtop)	UPDATE! F57 (Cooper, Cooper S Convertible)
--------------------------------	---------------------------------------	---------------------------------------	---

SITUATION

Customer complains wipers are noisy or chattering during wiper operation.



CAUSE

Wiper arms out of adjustment and/or windshield cowl misaligned.

PROCEDURE

Clean windshield and wiper blades with suitable cleaner and check wiper arm adjustment as follows.

	<ol style="list-style-type: none"> 1. Use repair instruction 61 61 010 to align wiper arms.
	<ol style="list-style-type: none"> 2. If out of adjustment, use tools shown to align wiper arm.

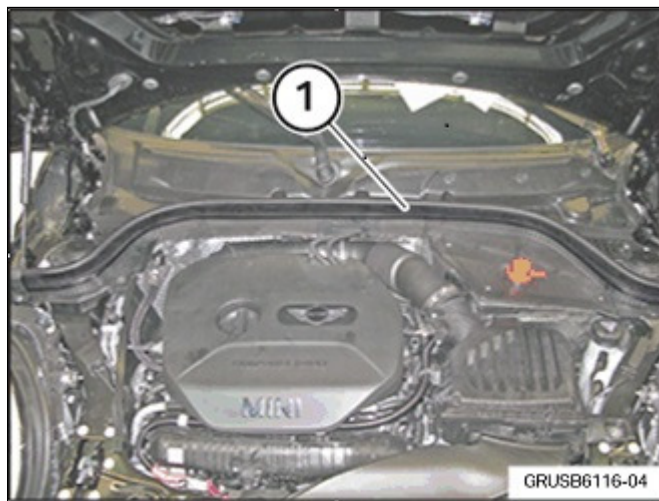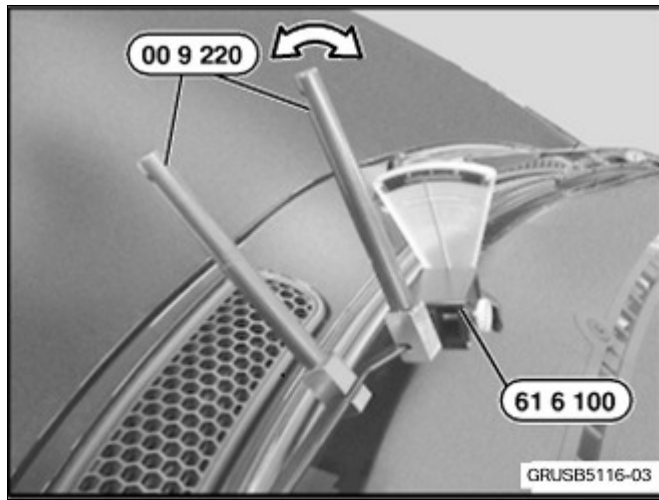

3. If necessary remove seal (1), adjust wiper cowl as per repair instruction 51 13 124.
4. Pay special attention to wiper motor shaft interference with wiper cowl.

WARRANTY INFORMATION

Covered under the terms of the MINI New Passenger Car Limited Warranty for the wiper blade inserts (up to the first 2,000 miles) or in conjunction with another covered repair.

Defect Code:	61 61 06 41 00	
Labor Operation:	Labor Allowance:	Description:
61 61 010	Refer to KSD2	Checking and adjusting windscreen wiper arms with respect to windscreen.

If you are using a Main labor code for another repair, use the Plus code labor operation 61 61 510 instead.

[Copyright ©2016 BMW of North America, Inc.]