



SUBJECT

EME No Longer Communicates after HV Charging

MODEL

I01 (i3)

Produced after 1/10/2015

SITUATION

On the affected i3 vehicles (with software integration levels 15-11-501 through 15-11-504), the Drive Readiness can no longer be established after attempting to charge the HV battery. In such a case, EME no longer communicates with ISTA.

In some cases, various calibration values are lost (e.g. resolver angle).

CAUSE

Vehicle was charged before Transport Mode removal. This may cause:

- Irreparable damage to the EME.
- Taught-in values to be set to default values, requiring repetition of teach-in process.

PROCEDURE

NOTE: It is absolutely essential that the vehicle have transport mode removed before charging is attempted.

After programming with software level 16-07-501 (ISTA 3.59.x), this fault can no longer occur.

If the EME cannot communicate, submit “EME Not Communicating” TC case.

WARRANTY INFORMATION

Not applicable.

[Copyright ©2016 BMW of North America, Inc.]