

**SUBJECT****Fault Code 222C02 - Modified Procedure for Exchanging EME****MODEL**

I12

SITUATION

EME needs to be programmed after replacement.

Programming can cause fault code “222C02 – Electronic immobilizer protection against tampering: expected response implausible” to be stored.

CAUSE

Improper software (up to ISTA/P 3.58.1- up to and including I001-16-03-502)

CORRECTION

Program with proper software or apply workaround described.

PROCEDURE

Only properly trained personnel, who have passed all applicable technical training courses, should perform any maintenance or repairs on any Hybrid or Electric Vehicle. Work performed by unqualified persons may result in severe injury or damage to the vehicle. Additional information may be found in REP 61 00... Observe safety instructions when handling electric vehicles.

Until software without this issue is released (ISTA/P 3.59.0 , I001 16-07-500), use the following workaround:

1. When necessary, replace EME following the repair instructions.
2. Switch on terminal 15 and leave it switched on for a minimum of one minute (60 seconds). Do not change terminals during this time.
3. After this time, program and code the vehicle using ISTA/P as normal.

After ISTA/P 3.59.0 is released, the vehicle can be programmed and coded directly after the EME replacement.

WARRANTY INFORMATION

Not applicable.

[Copyright ©2016 BMW of North America, Inc.]