

Measure no.

US 62533649-01

Subject

Rust stains on both case holders

Status date (mm/dd/yy)

3/16/16

Status

Accepted

Organization

US, MOT

Date created (mm/dd/yy)

3/16/16

Created by

Christine Koehling

PQM Problem reference**Release date (mm/dd/yy)****Approved by****Dealer release**

Allow automatic release

Vehicles affected**E series**

K53 K54

Engine**Body****Production period (from/to)**

(mm/dd/yy)

/

Comment on production period

Up to 8/3/16

Feedback (all cases relating to**measure up to) (mm/dd/yy)****Complaint**

Rust stains occur in the rear area of the case holders.

Cause

Rusty water emerges through the vent hole that is required for the production process.

Measure

As of 9/3/2016, the vent hole in the case holders has been sealed at the factory.

In the event of a complaint, clean the bore hole in the case holders (see picture_001.jpg).

that have already been supplied and seal them with a locally available polyurethane sealant such as Sikaflex 221 Black.

Complaint

	Fault location	Fault type	Fault place
#	46/54 Case holder	Corrosion	Both sides / all

Cause

#	Fault location	Fault type	Fault place
---	-----------------------	-------------------	--------------------

