

**SUBJECT**

Erroneous Electric Power Steering (EPS) Fault

MODEL

G12 (7 Series sedan)

SITUATION

After performing the vehicle test with ISTA/D, fault “0x4823EE – control unit internal – ZFLS – hardware – EEPROM” may be displayed for the EPS.

CAUSE

EPS software

INFORMATION

This is an erroneous fault! After a terminal status change, the fault disappears until the next diagnostic session.

Do not replace any parts as this will not provide a resolution.

This erroneous fault will be eliminated with ISTA/P 3.59 (I-Level S15A 16-07-501).

WARRANTY INFORMATION

Not applicable.

[Copyright ©2016 BMW of North America, Inc.]