



SI M61 01 16  
General Electrical Systems

April 2016  
Technical Service

## SUBJECT

### Front Windshield Wiper Noises

## MODEL

F54 (Cooper, Cooper S Clubman)

F55 (Cooper, Cooper S 4 Door Hardtop)

F56 (Cooper, Cooper S 2 Door Hardtop)

## SITUATION

Customer complains wipers are noisy or chattering during wiper operation.



## CAUSE

Wiper arms out of adjustment and/or windshield cowl misaligned.

## PROCEDURE

Clean windshield and wiper blades with suitable cleaner and check wiper arm adjustment as follows.

	<ol style="list-style-type: none"> <li>1. Use repair instruction 61 61 010 to align wiper arms.</li> </ol>
	<ol style="list-style-type: none"> <li>2. If out of adjustment, use tools shown to align wiper arm.</li> </ol>

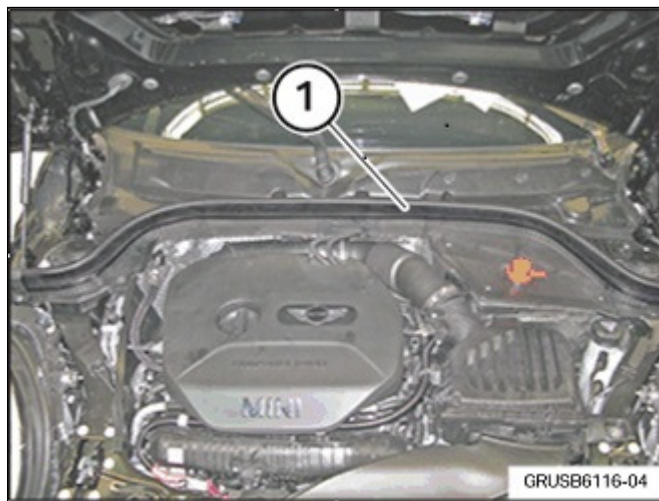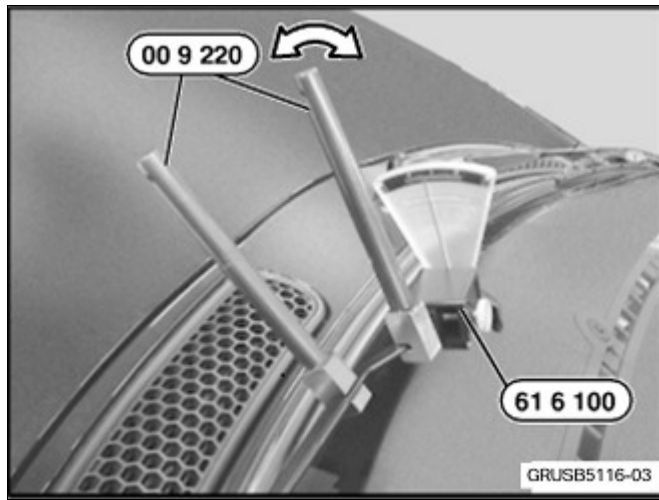

3. If necessary remove seal (1), adjust wiper cowl as per repair instruction 51 13 124.
4. Pay special attention to wiper motor shaft interference with wiper cowl.

**WARRANTY INFORMATION**

Covered under the terms of the MINI New Passenger Car Limited Warranty for the wiper blade inserts (up to the first 2,000 miles) or in conjunction with another covered repair.

<b>Defect Code:</b>	<b>61 61 06 41 00</b>	
<b>Labor Operation:</b>	<b>Labor Allowance:</b>	<b>Description:</b>
61 61 010	Refer to KSD2	Checking and adjusting windscreen wiper arms with respect to windscreen.

If you are using a Main labor code for another repair, use the Plus code labor operation 61 61 510 instead.

[ Copyright ©2016 BMW of North America, Inc. ]