



Airbag (SRS) Warning Lamp Illuminated

MODEL

F85 X5 M	F86 X6 M	Vehicles produced from 11/30/14 to 1/31/16
----------	----------	--

SITUATION

Airbag lamp (SRS) is illuminated and both of the following fault codes are stored:

- 930904 - Airbag driver stage 1: Resistance too large
- 93090A - Airbag driver stage 2: Resistance too large

CAUSE

Coil spring cassette damage.

PROCEDURE

If the vehicle fits ALL of the following criteria:

- Vehicle falls within the production range above
- SRS Lamp is illuminated
- BOTH fault codes 930904 and 93090A are stored

Then the coil spring cassette assembly should be replaced, and the test plans for both fault codes do not need to be performed.

If the vehicle does not meet ALL of the criteria above then please follow the test plan for each stored fault code.

PARTS INFORMATION

Part Number	Description	Quantity
61 31 9 320 136	Switch cluster steering column	1

WARRANTY INFORMATION

Covered under the terms of the BMW New Vehicle Limited Warranty for Passenger Cars and Light Trucks or the BMW Certified Pre-Owned Program.

Defect Code:	61 12 55 79 00	
Labor Operation:	Labor Allowance:	Description:

00 00 006	Refer to KSD2	Performing “vehicle test” (with vehicle diagnosis system – checking faults)
And:		
61 21 528	Refer to KSD2	Connect an approved battery charger/power supply(indicated in KSD2 as “Charging battery”)
And:		
61 31 513	Refer to KSD2	Replacing steering column switch cluster (after vehicle diagnosis)
And:		
61 00 730	Refer to KSD2	Programming / encoding control unit (s)

If you are using a Main labor code for another repair, use the Plus code labor operation 00 00 556 instead.

Refer to KSD2 for the corresponding flat rate unit (FRU) allowances.

Vehicle Programming and Coding

Control module failures that occur during programming:

- Please claim these consequential repairs under the defect code listed in this bulletin and use the applicable KSD2 labor operations.

Other Repairs

Control module failures that occur prior to programming:

- When covered under an applicable limited warranty, claim these repairs using the applicable defect code and labor operations in KSD2.

[Copyright ©2016 BMW of North America, Inc.]