



Service Action: Replace the Manufacturer's Certification Label

Please perform the procedure outlined in this Service Information on all affected vehicles before customer delivery. In the event the customer has already taken delivery of the vehicle, please perform the procedure the next time the vehicle is in the shop.

MODEL

F16 (X6)

SITUATION

The gross vehicle weight data was not specified correctly on the B-pillar label.

AFFECTED VEHICLES


This Service Action involves certain F16 (X6) vehicles manufactured from November 24, 2015 to February 25, 2016.

Vehicles which require this Service Action to be completed will show it as "Open" when checked either in AIR, the "Service Menu" of DCSnet (Dealer Communication System) or with the Key Reader.

CORRECTION

Replace manufacturer's certification label on the B-pillar.

PROCEDURE

	<ol style="list-style-type: none"> 1. Locate label on lower part of B-pillar 2. Remove the incorrect label 3. Thoroughly clean the adhesive area.
	<ol style="list-style-type: none"> 4. Affix the correct label. <p>The correct weight data is as</p>

MFD BY BAYERISCHE MOTOREN WERKE AG 01/2016 GVWR lbs kg TIRE / RIM GAWR FRONT lbs kg WITH 255/50 R19 /9.0J x 19 GAWR REAR lbs kg WITH 255/50 R19 /9.0J x 19 THIS VEHICLE CONFORMS TO ALL APPLICABLE U. S. FEDERAL MOTOR VEHICLE SAFETY STANDARDS IN EFFECT ON THE DATE OF MANUFACTURE SHOWN ABOVE. 5UXKU2C55G TYPE: MPV 416M 7 320 729 GRUSB7116-02			follows: GVWR: 6010 lbs, 2726 kg GAWR FRONT: 2730 lbs, 1238 kg GAWR REAR: 3380 lbs, 1533 kg
---	--	--	--

PARTS INFORMATION

Please do not enter your order as a coded part or it will delay receiving the label. Please follow the below process:

Email your request to codedparts@bmwna.com – the subject line must be [SIB71 01 16](#).

The email must contain your Dealer code, the full 17 digits of the VIN, the part number (07 14 7 320 729), your name, phone number and full shipping address.

Part Number	Description	Quantity
07 14 7 320 729	Manufacturer's certification label	1

WARRANTY INFORMATION

Reimbursement for this Service Action will be via normal claim entry utilizing the following information:

Defect Code:	00 71 24 02 00	
Labor Operation:	Labor Allowance:	Description:
00 64 572	3 FRU	Replace the manufacturer's certification label (Plus work)

[Copyright ©2016 BMW of North America, Inc.]