



## EME Fault Code 222C02 Following Replacement or Programming- Diagnosis

### MODEL

I01 (i3 and i3 REx)	I12 (i8)
---------------------	----------

### SITUATION

Programming, (e.g. following replacement), can cause EME fault code “222C02 – Electronic immobilizer protection against tampering: expected response implausible” to be stored. After clearing, the fault comes back during a test drive.

### CAUSE

Improper EME software

### CORRECTION

Apply workaround described.

### PROCEDURE

**Only properly trained personnel, who have passed all applicable technical training courses, should perform any maintenance or repairs on any Hybrid or Electric Vehicle. Work performed by unqualified persons may result in severe injury or damage to the vehicle. Additional information may be found in REP 61 00... Observe safety instructions when handling electric vehicles.**

If this behavior is observed, please use the following workaround:

- 1. Make sure that the vehicle stays in sleep mode for a minimum of 45 minutes.
- 2. Switch on terminal 15, and leave switched on, for a minimum of one minute (60 seconds). Do not change terminals during this time.
- 3. After these waiting periods, program and code the vehicle using ISTA/P as normal.

### WARRANTY

Not applicable.

[ Copyright ©2016 BMW of North America, Inc. ]