

BBK

Bulletin No.: 20760
Date: February 2016



Recall Bulletin

PRODUCT SAFETY RECALL

SUBJECT: Brake Pedal Pivot Nut/Bolt Loose
MODELS: 2015 – 2016 Chevrolet Silverado HD
2015 – 2016 Chevrolet Tahoe PPV (RPO 9C1)
2015 – 2016 GMC Sierra HD

RWA -
MORGAN -

Vehicles involved in this recall were placed on stop delivery February 3, 2016. Once the service procedure contained in this bulletin has been performed on the vehicle, the vehicle is released from stop delivery and the vehicle can be delivered to the customer.

All involved vehicles that are in dealer inventory must be held and not delivered to customers, dealer traded, or used for demonstration purposes until the repair contained in this bulletin has been performed on the vehicle.

It is a violation of Federal law for a dealer to deliver a new motor vehicle or any new or used item of motor vehicle equipment (including a tire) covered by this notification under a sale or lease until the defect or noncompliance is remedied.

CONDITION

General Motors has decided that a defect which relates to motor vehicle safety exists in certain 2015-2016 model year Chevrolet Silverado and GMC Sierra 2500/3500 Heavy Duty Pickup Trucks and Chevrolet Tahoe PPV (RPO 9C1) vehicles. The brake pedal pivot nut on these vehicles may become loose, causing the brake pedal to be loose or inoperative. If the brake pedal becomes loose or inoperative, the driver may be unable to safely stop the vehicle through application of the brake pedal, increasing the risk of a crash. A loose pedal may also interfere with the accelerator pedal, increasing the risk of a crash.

CORRECTION

Dealers are to inspect the pivot bolt installation to determine whether the vehicle has already received the production remedy. If not, dealer will add adhesive to the nut, and reinstall the nut at an increased torque.

VEHICLES INVOLVED

All involved vehicles are identified by Vehicle Identification Number on the Investigate Vehicle History screen in GM Global Warranty Management system. Dealership service personnel should always check this site to confirm vehicle involvement prior to beginning any required inspections and/or repairs. It is important to routinely use this tool to verify eligibility because not all similar vehicles may be involved regardless of description or option content.

For dealers with involved vehicles, a listing with involved vehicles containing the complete vehicle identification number, customer name, and address information has been prepared and will be provided to US and Canadian dealers through the GM GlobalConnect Recall Reports, or

sent directly to export dealers. Dealers will not have a report available if they have no involved vehicles currently assigned.

The listing may contain customer names and addresses obtained from Motor Vehicle Registration Records. The use of such motor vehicle registration data for any purpose other than follow-up necessary to complete this recall is a violation of law in several states/provinces/countries. Accordingly, you are urged to limit the use of this report to the follow-up necessary to complete this recall.


PART INFORMATION

Choose one of the following high strength (red) Threadlocker part numbers.

Part Number	Description	Quantity/Vehicle
Obtain Locally	Permatex High Strength Threadlocker 27100 (0.20 Oz)	1 tube fixes approx. 25 vehicles
Obtain Locally	Loctite Threadlocker Red 271 209741 (6 ml)	1 tube fixes approx. 25 vehicles

SERVICE PROCEDURE

- Using an inspection mirror, determine if the brake pedal pivot nut is on the outboard side of the vehicle.

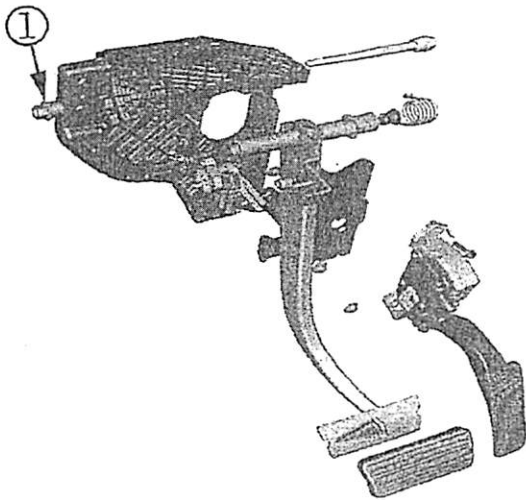


4404307

- If the brake pedal pivot nut (1) is on the outboard side of the vehicle, proceed to step 2.

~~2074-4881~~
~~2074-4881~~
~~2074-4881~~
~~2074-4881~~
~~2074-4881~~



~~ROCK~~
~~2065-3766~~
~~2059-2020~~
~~2060-2377~~

~~10~~
~~2060-2377~~

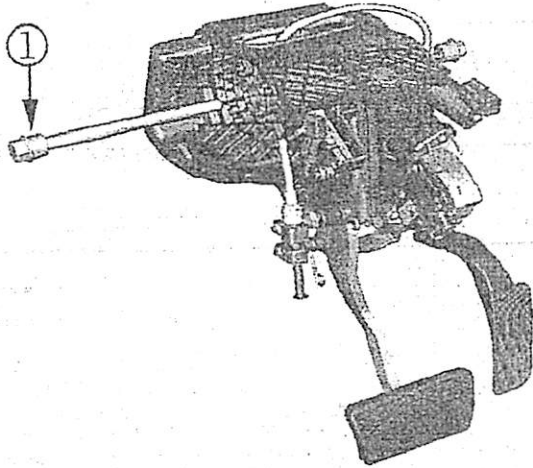

4404296


- If the brake pedal pivot bolt (1) is on the outboard side of the vehicle (nut on the inboard side), no further action is required.
2. Remove the Instrument Panel Knee Bolster. Refer to *Instrument Panel Knee Bolster Replacement* in SI.
 3. Remove the Floor Front Air Outlet Duct Replacement - Left Side. Refer to *Floor Front Air Outlet Duct Replacement - Left Side* in SI.

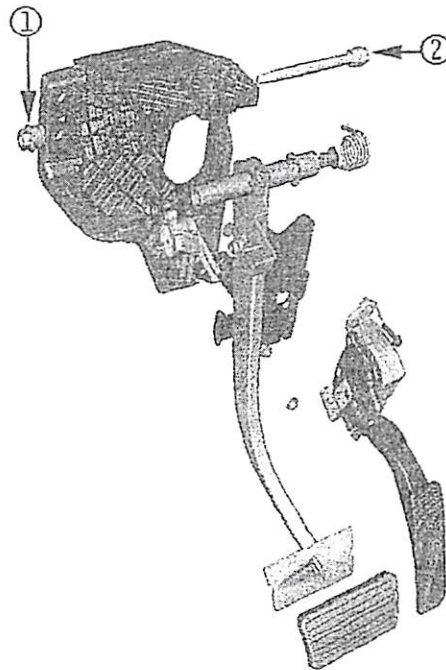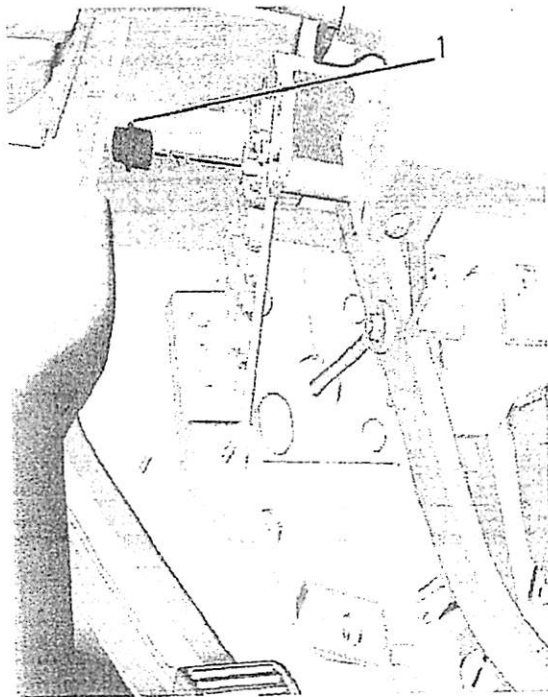

4404322

Caution: Apply pressure to the brake pedal pivot bolt while removing the nut to ensure the bolt does not back out of the housing. Part damage could occur if the bolt backs out of the housing.



4. Holding the brake pedal pivot bolt (2) with a box end wrench, remove the brake pedal pivot nut (1).

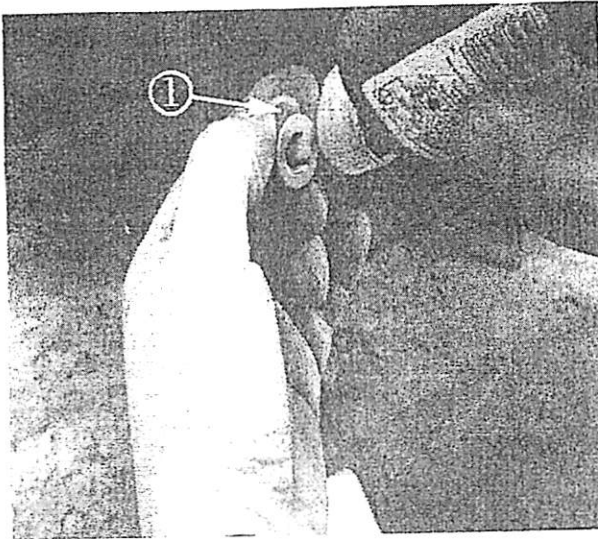

4404331

Note: Do NOT get threadlocker on the exterior of the brake pedal pivot nut. The exterior of the brake pedal pivot nut must be kept clean of threadlocker.

5. Holding the nut horizontally, apply two drops of red threadlocker to the threads in the collar portion (1) of the nut.

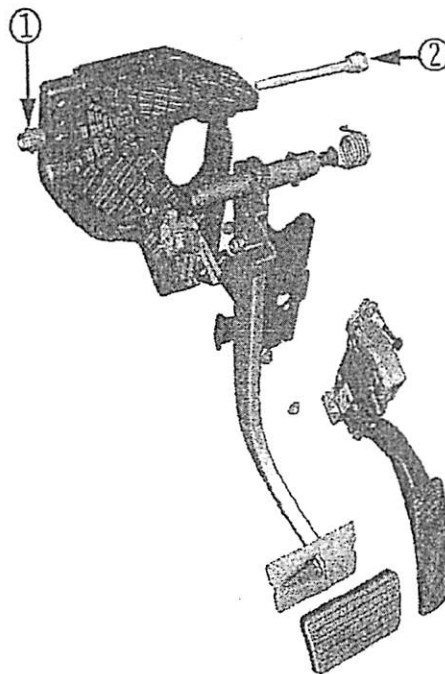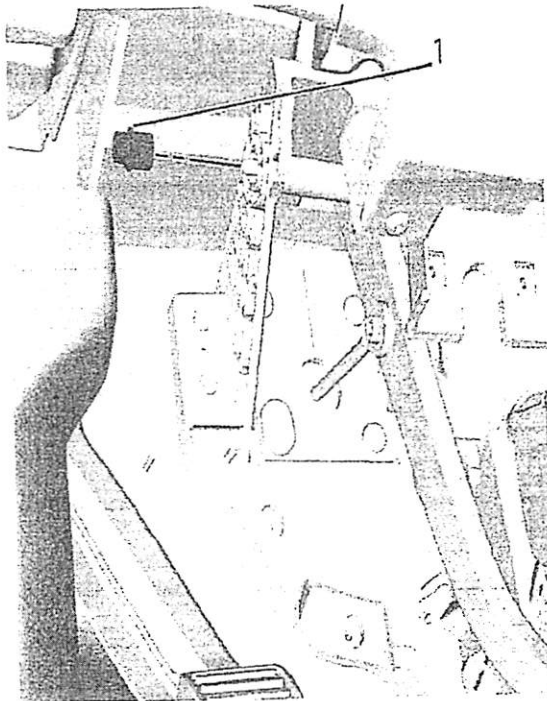

4404322

Caution: Apply pressure to the brake pedal pivot bolt while installing the nut to ensure the bolt does not back out of the housing. Part damage could occur if the bolt backs out of the housing.

6. Holding the brake pedal pivot bolt (2) with a box end wrench, install the brake pedal pivot nut (1).

7. Holding the brake pedal pivot bolt with a box end wrench, torque the brake pedal pivot nut to 26 Nm (19 lb ft).
8. Install the Floor Front Air Outlet Duct Replacement - Left Side. Refer to *Floor Front Air Outlet Duct Replacement - Left Side* in SI.
9. Install the Instrument Panel Knee Bolster. Refer to *Instrument Panel Knee Bolster Replacement* in SI.

COURTESY TRANSPORTATION – For US and Canada

The General Motors Courtesy Transportation program is intended to minimize customer inconvenience when a vehicle requires a repair that is covered by the New Vehicle Limited Warranties. The availability of courtesy transportation to customers whose vehicles are within the warranty coverage period and involved in a product program is very important in maintaining customer satisfaction. Dealers are to ensure that these customers understand that shuttle service or some other form of courtesy transportation is available and will be provided at no charge. Dealers should refer to the General Motors Service Policies and Procedures Manual for Courtesy Transportation guidelines.

WARRANTY TRANSACTION INFORMATION

Submit a transaction using the table below. All transactions should be submitted as a ZFAT transaction type, unless noted otherwise.

Labor Code	Description	Labor Time	Net Item
9102017	Inspect Brake Pedal Pivot Nut	0.2	N/A
9102038	Apply Threadlocker to Brake Pedal Pivot Nut	0.4	*

* The amount identified in "Net Item" should represent the actual sum total of the current GMCCA Dealer net price for Threadlocker needed to perform the required repairs, not to exceed \$0.40 USD/CAD.

CUSTOMER NOTIFICATION – For US and Canada

General Motors will notify customers of this recall on their vehicle.

CUSTOMER NOTIFICATION – For Export

Letters will be sent to known owners of record located within areas covered by the US National Traffic and Motor Vehicle Safety Act.

DEALER RECALL RESPONSIBILITY – For US and Export (US States, Territories, and Possessions)

It is a violation of Federal law for a dealer to deliver a new motor vehicle or any new or used item of motor vehicle equipment (including a tire) covered by this notification under a sale or lease until the defect or noncompliance is remedied.

The US National Traffic and Motor Vehicle Safety Act provides that each vehicle that is subject to a recall of this type must be adequately repaired within a reasonable time after the customer has tendered it for repair. A failure to repair within sixty days after tender of a vehicle is prima facie evidence of failure to repair within a reasonable time. If the condition is not adequately repaired within a reasonable time, the customer may be entitled to an identical or reasonably equivalent vehicle at no charge or to a refund of the purchase price less a reasonable allowance for depreciation. To avoid having to provide these burdensome remedies, every effort must be