VOLVO CAR SERVICE AND PARTS BUSINESS



Technical Journal

TITLE: XC90 Front brake noise

REF NO:	ISSUING DEPARTMENT:	CAR MARKET:		
TJ 30934.9.1	Technical Service	United States and Canada		
3 US 7	PARTNER:	ISSUE DATE:	STATUS DATE:	
	7510 Volvo Car USA	2016-12-09	2016-12-14	
FUNC GROUP: 5112	FUNC DESC: Brake drum; brake disc	Page	1 of 2	

"Right first time in Time"

Attachment

Vehicle Type

Туре		Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	Chassis range	Struc Week Range
256	10	B4204T23					2016-2017		0000001-0135577	201537-201640
256	A2	B4204T27					2016-2017		0000001-0135577	201505-201640
256	BC	B1BPHEV					2016-2017		0000001-0135577	201526-201640

CSC Customer Symptom Codes

Code	Description
B6	Brakes/Unusual noise/Front

VST Operation Number

VST Operation Number	Description			
51104-0	Brake pads front 2 wheels replace			
51117-0	Brake discs front x2 replace			

DTC Diagnostic Trouble Codes

Rows beginning with * are modified

Note! If using a printed copy of this Technical Journal, first check for the latest online version.

Text

Produced in the USA and available as an electronic document. Hard copy documents are printed in USA on recycled paper containing a minimum of 50% wastepaper and 10% post-consumer waste. © 2016 VOLVO CAR USA, LLC

Technical Journal 30934.9.1



DESCRIPTION:

If squealing noise occurs from front brakes, then follow the instruction under Service.

- * VST operation changed
- * Brake grease part number added
- VIDA = Vehicle Information and Diagnostics for Aftersales

SERVICE:

Replace front discs according to VIDA, if the car has 18" (VDN= RE03) front brake discs and built before chassis number 040328, the new brake discs have changed metal composition in order to reduce squealing noise.

Also replace front brake pads: P/n 31499906 US/CA-market.

For cars built from chassis number 040329- and if the car has 18" (VDN= RE03) front brake discs, replace front brake pads: P/n 31499906 US/CA-market.

For cars built before chassis number -135577 and if the car has 19" (VDN= RE04) front brake discs, replace front brake pads: P/n 31499906 US/CA-market.

Please use Wurth part# 31400019 on locations specified as per VIDA instructions for grease applied to caliper bracket mounting locations.

VEHICLE REPORT:

Only if the noise occurs on vehicles after 2016 week 40, also attach a sound file in to the report.