VOLVO CAR SERVICE AND PARTS BUSINESS



Technical Journal

TITLE: Seats second row, outer seats, noise

REF NO:	ISSUING DEPARTMENT:		ARKET:
TJ 30599.3.1	Technical Service		s and Canada
3 US 7	PARTNER:	ISSUE DATE:	STATUS DATE:
	7510 Volvo Car USA	2016-11-22	2016-11-30
FUNC GROUP: 8530	FUNC DESC: Rear seat, passenger seat, bench	Page ⁻	1 of 12

"Right first time in Time"

Attachment

File Name	File Size
TJ 30599.pdf	4.0000 MB

Vehicle Type

Туре	Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	Chassis range	Struc Week Range
256						2016-2016		0000561-0079653	201505-201609

CSC Customer Symptom Codes

Code	Description
ZO	Rear seat/Squeak/rattle

VST Operation Number

VST Operation Number	Description
98641-2	Rear seat adjust acc. to TJ 30599

DTC Diagnostic Trouble Codes

Rows beginning with * are modified

Note! If using a printed copy of this Technical Journal, first check for the latest online version.

Text

Produced in the USA and available as an electronic document. Hard copy documents are printed in USA on recycled paper containing a minimum of 50% wastepaper and 10% post-consumer waste. © 2016 VOLVO CAR USA, LLC

Technical Journal 30599.3.1



DESCRIPTION:

When driving on rough roads a rattling or creaking noise may come from the rear lower area, on the outer seats in the second row.

SERVICE:

* Note that the new parts in the kit <u>must be installed or replaced even if there is a similar part mounted</u> <u>already</u>.

Use attached repair method TJ 30599, use kit p/n 31447976.

Note: Observe that page 10 and onwards in the method, only applies for cars with chassis number. up to 25976. On later cars, the sliding rails has been modified.

Also observe that the Operation no is split in two variants, see Volvo standard times:

A = Ch.nr. -25976 B = Ch.nr. 25977-

VEHICLE REPORT:

Yes, please submit a Vehicle Report if the service solution described in this TJ has no effect. Use concern area "Vehicle Report" and sub concern area "Support Not Needed", use function group 8530.

To view TJ attachment continue to next page. This TJ has one attachment.

VOLVO	Volvo Car Customer Service	TJ	30599
Title	Rear seat, second row	Page	1 (10)
Action	Product fix	Operation number:	98641-2

2016-09

First issue

1


Model year	Model
2016	XC90 (16-)

Materials				
Materials	Qty.	Part No.	Notes	
Cleaning agent	1.0	1161721	0.05;	
Таре	1.0	9511083	120mm : Wurth part 199230040	
Service kit	1.0	31447976		


Special tools			
Description	Part No.		
Interior trim remover	981 4071		

Equipment			
Designation	Part No.		
Tape measure			

Orientation view

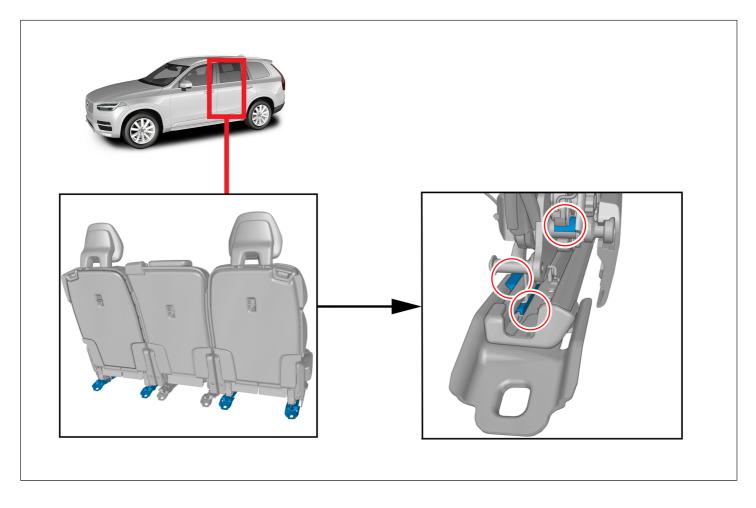


Color symbols

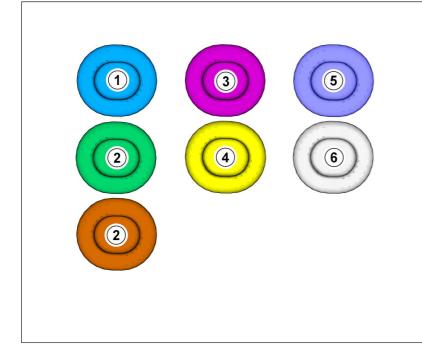

Note! This colour chart displays (in colour print and electronic version) the importance of the different colours used in the images of the method steps.

- 1. Used for focused component, the component with which you will do something.
- 2. Used as extra colors when you need to show or differentiate additional parts.
- 3 . Used for attachments that are to be removed/installed. May be screws, clips, connectors, etc.
- 4 . Used when the component is not fully removed from the vehicle but only hung to the side.
- 5 . Used for standard tools and special tools.
- 6 . Used as background color for vehicle components.

Vehicles with seven seats

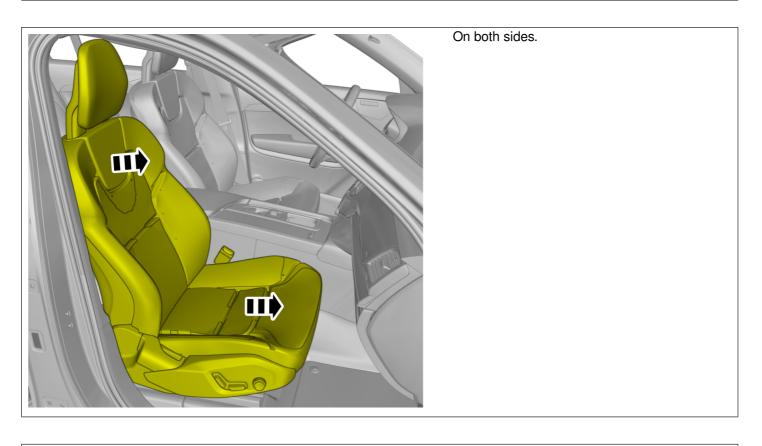


Concerns outer position






Removal

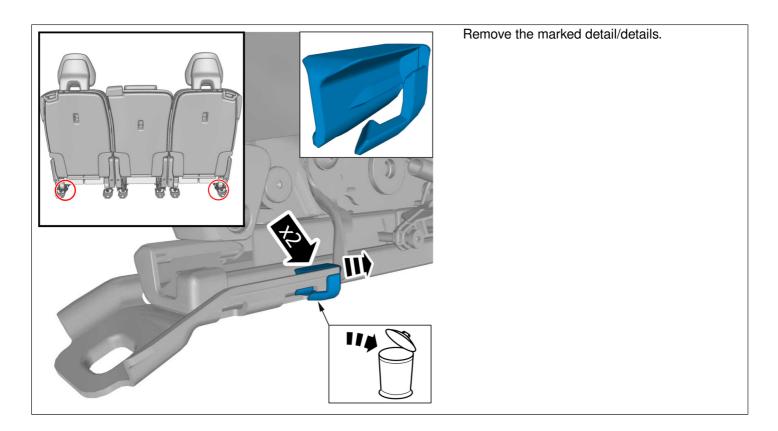


TJ 30599	Page 5 (10)
Installation	
<image/>	Install the marked component. On both sides.


Removal

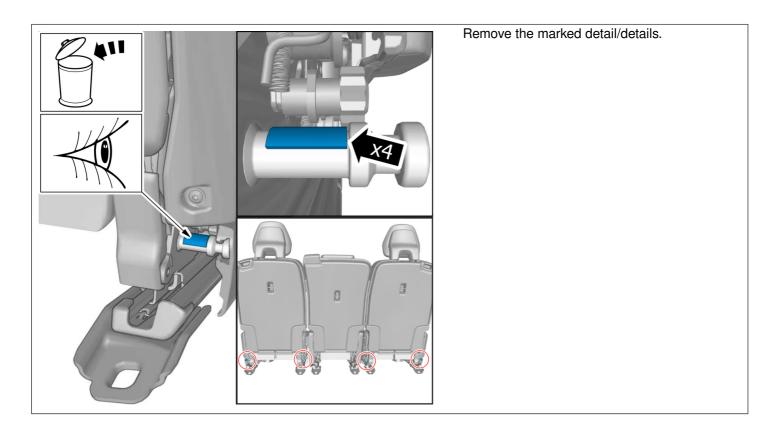

TJ 30599

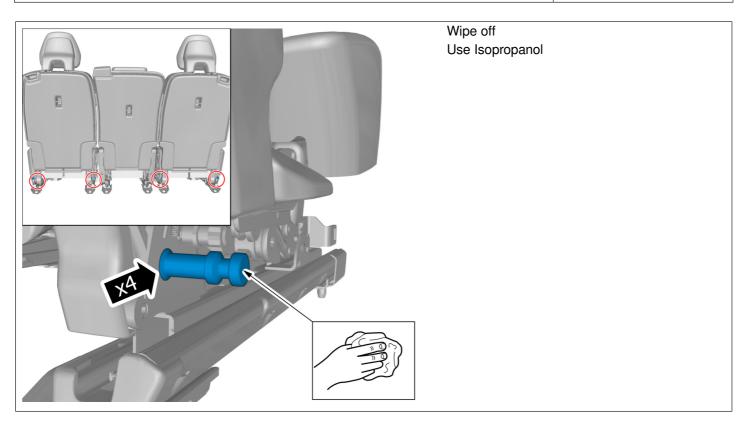


Installation

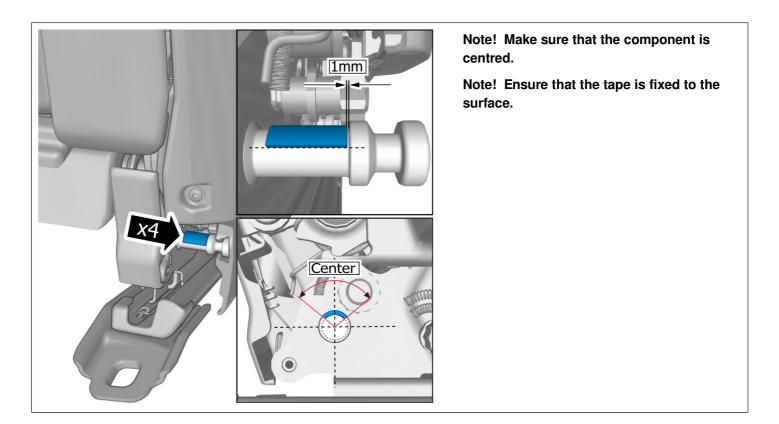


Page 7 (10)


Vehicles manfactured before chassis number 25976

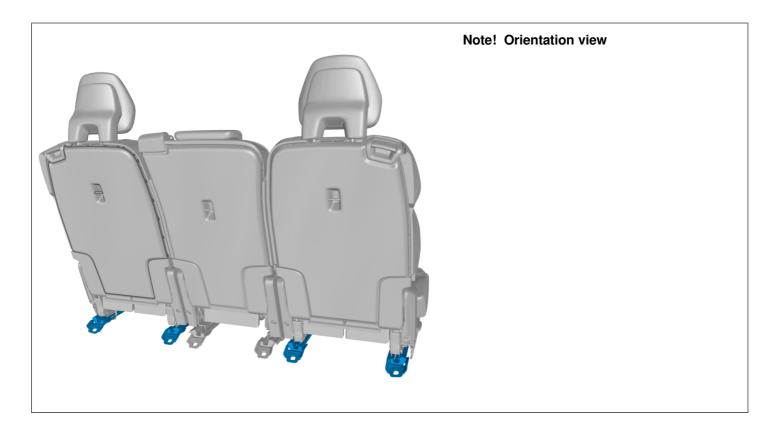


Adjustment

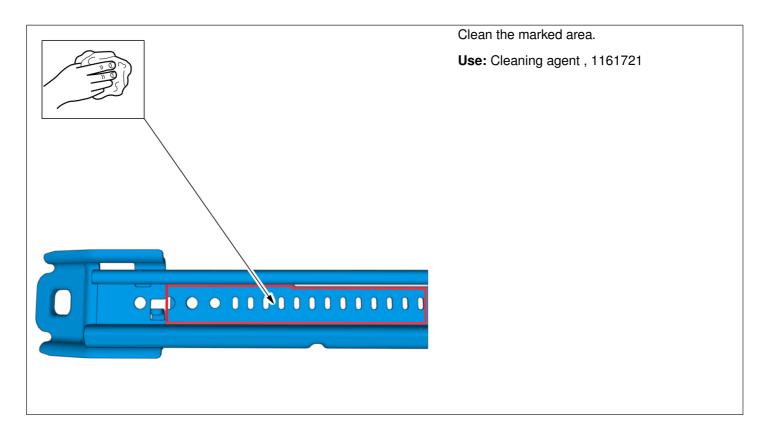


TJ 30599

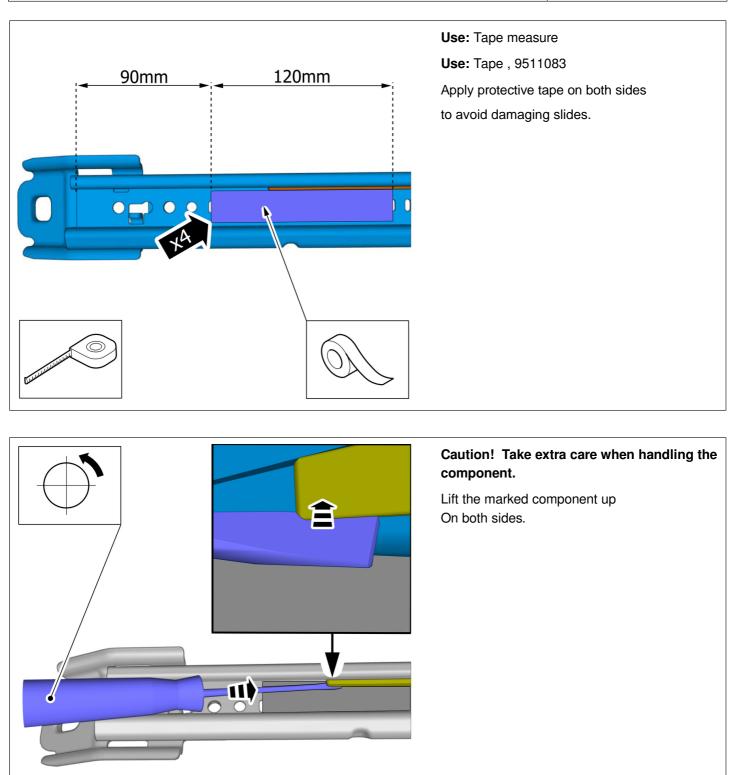

TJ 30599

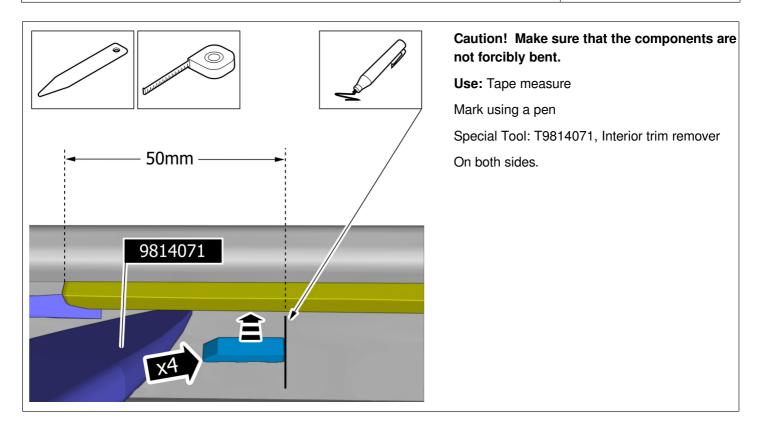

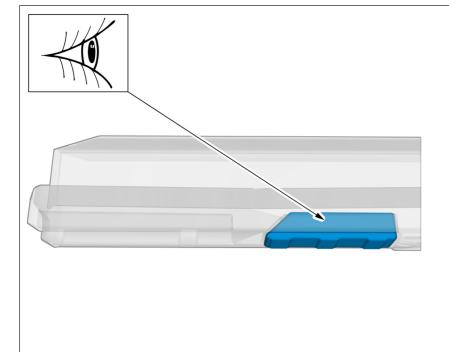

Caution! Make sure that the component is positioned correctly.

On both sides.

