



www.procompusa.com  
2360 Boswell Road, Chula Vista, CA 91914  
Phone: (800) 776-0767 Fax: (619) 216-9404

**Date:** 6/10/2016

**Attention:** ABS wire routing

**Models:** 2016 Toyota Tacoma 4WD, Tacoma PreRunner 2WD

**Affected Pro Comp Kit numbers:**  
57397B, K5089B

**Overview:** In monitoring our technical service inquiries we have identified the potential for routing issues that allow the ABS wire to be pinched between its retention bracket and the coil spring at full steering lock. **See figure A**

The installation, routing and routine inspection of the ABS wires and brake lines is critical to prevent abrasion or damage.

**Figure A**



**Solution:** The following instruction is offered to improve the ABS wire routing for new lift installations. Carefully remove the ABS wire from its upper retention bracket, outlined in red in **figure A**. Remove the upper retention bracket and secure the ABS wire with an Adele clamp using the previously removed bolt. See **figure B**. Repeat these steps for the other side. Make certain there is no pinching, rubbing, or stretching of the ABS wires.

**Figure B Front view**

**Figure B Rear view**



www.procompusa.com  
2360 Boswell Road, Chula Vista, CA 91914  
Phone: (800) 776-0767 Fax: (619) 216-9404