

On some 2016MY Soul (PS) vehicles, you may see a Forward Collision Warning (FCW) indicator may appear on the instrument cluster with no DTC's present. This condition may be caused by incorrect/lost variant coding of the Lane Departure Warning System (LDWS) camera, or when replacing with a new camera. Follow the procedure outlined below to resolve the concern



Service Procedure:

- 1. Use KDS/GDS to access the LDWS Camera Variant Coding screen.
- 2. Enter the values shown below to correctly code the camera.

Item	Setting Value
Vehicle Code:	Default
Country Code:	North America
Left/Right hand drive:	LHD
Transmission Type:	Automatic
HBA Option:	NONE
LKAS/LDWS Option:	LDWS
Vehicle Body Type:	NONE
SLIF Option	NONE
FCW/AEB Option:	FCWS (Camera Only)
Attention Assist:	NONE