

Service Alert No: 001320

Title: 2017 MAZDA6 TURN SIGNAL SWITCH DOES NOT CANCEL

Some customers may complain about a turn signal switch that does not cancel. This concern may have occurred after an accessory fog light installation by the port.

Repair Procedure

Note: This service alert does not apply to 2017 Mazda6 vehicles with Grand Touring trim.

1. Verify customer concern.
2. Is the vehicle equipped with fog lamps?



- a. Yes - Proceed to step 3.
- b. No - This service alert does not apply. Proceed with normal Workshop Manual diagnosis.

3. Is the vehicle equipped with an Auto Light Sensor?



- Yes - Replace the turn signal switch with part number BALN-66-122
- No - Replace the turn signal switch with part number BALM-66-122

Note: Do not use the VIN to look up part number in the GEPC.

4. Verify repair.