



# SERVICE BULLETIN

Classification: EM16-001a	Reference: NTB16-007a	Date: March 22, 2016
------------------------------	--------------------------	-------------------------

## 2016 ALTIMA; VIBRATION FELT IN CENTER CONSOLE AND DRONING HEARD WHILE DRIVING

This bulletin has been amended. The APPLIED DATE information has been revised. Please discard previous versions of this bulletin.

**APPLIED VEHICLES:** 2016 Altima (L33)  
**APPLIED VIN:** Built before 1N4AL3AP(\*)GN 317613  
 1N4AL3AP(\*)GC 137589  
**APPLIED DATE:** Built before December 9, 2015  
**APPLIED ENGINE:** QR25DE only

### IF YOU CONFIRM

A vibration is felt in the center console armrest pad, seat base and steering wheel that is accompanied by a droning sound.

- Only while driving (does not occur at idle).

**And**

- With engine RPM at approximately 1,600 to 1,800.

### ACTION

Remove two rubber “front exhaust tube hangers” shown in Figure 1 that support the rear of the center exhaust tube.

**IMPORTANT:** Vehicles built after the above Applied VIN and Date are no longer equipped with exhaust hangers installed in these locations.

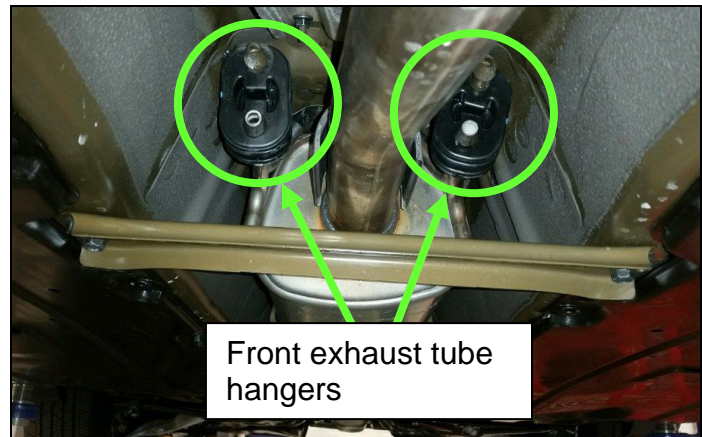


Figure 1

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

**CLAIMS INFORMATION**

Submit a Primary Operation (PO) type line claim using the following claims coding:

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
Remove Exhaust Hangers	(1)	FX53AA	ZN	32	0.2

