



Innovation
that excites

NISSAN BULLETIN

Engine Harness Ground Dealer Inventory Service Action

Reference: PC455
Date: April 14, 2016

Attention: Dealer Principal, Sales, Service & Parts Managers

| Affected Models/Years: | Affected Population: | Dealer Inventory: | SERVICE COMM Activation date: |
|------------------------|----------------------|-------------------|-------------------------------|
| MY2016 Titan XD | NA | 1,268 | April 14, 2016 |

*******Dealer Announcement*******

Nissan is conducting a dealer inventory service action to torque the Engine Harness Ground to specification on **1,268** specific 2016 Titan XD vehicles identified in Service Comm.

These vehicles are either currently in dealer inventory or assigned and in transit to the dealer.

*******What Dealers Should Do*******

PLEASE FOLLOW THE ATTACHED REPAIR INSTRUCTIONS:

1. Verify if vehicles currently in dealer inventory are affected by this inventory service action using Service Comm **I.D. PC455**.
 - **As a reminder new vehicles in dealer inventory can be also be identified using DCS (Sales-> Vehicle Inventory, and filter by Open Campaign) or Service Comm.**
2. Use the attached procedure to torque the Engine Harness Ground to specification 13.0 ft-lb (18.0 Nm).
3. The service department should submit the applicable warranty claim for the action performed so it can be closed on Service Comm and release the vehicle.

******* Dealer Responsibility *******

It is the dealer's responsibility to check Service Comm using the appropriate campaign I.D for the inspection status on each affected vehicle currently in inventory. Nissan requests dealers to perform this repair on vehicles in inventory prior to being retailed to ensure customer satisfaction.

NISSAN NORTH AMERICA, INC.
Aftersales DIVISION



SERVICE CAMPAIGN BULLETIN

PC455 - 2016 TITAN (A61) – ENGINE HARNES GROUND TORQUE

SERVICE PROCEDURE:

1. Park the vehicle in a safe location.
2. Turn the steering wheel fully to the right.
3. Locate the Engine Harness Ground by looking through the right front wheel well (Figure 1).

NOTE: There are 2 ground wires next to each other. Tighten the **UPPER** bolt for the Engine Harness Ground wire.



Figure 1

4. Using a 14 mm socket, a long extension and a torque wrench.
 - Torque the engine harness ground to:
 - 18.0 N·m (**13.0 ft-lb**)



Figure 2

5. Release the vehicle and submit warranty claim using the below claim information.

CLAIMS INFORMATION

Submit claim using the following claims coding:

Work Order Line Type: "CM" Campaign

Campaign: PC455

| | | |
|-------------------------------------|-----------------|-----------------------|
| Claim Type: | CM | |
| PNC: | PC455 | |
| Symptom: | ZZ | |
| Diagnosis: | 99 | |
| Description: | Op Codes | Flat Rate Time |
| Torque Engine Harness Ground | PC4550 | 0.2 Hr |