



Technical Journal

TITLE:

Leather seats, improvements on wrinkles and wear

REF NO:
TJ 32005.1.0

ISSUING DEPARTMENT:
Technical Service

CAR MARKET:
United States and Canada

PARTNER:
3 US 7510 Volvo Car USA

ISSUE DATE:
2016-10-31

STATUS DATE:
2016-11-07

FUNC GROUP:
8521

FUNC DESC:
Front seat, complete

Page 1 of 6

“Right first time in Time”

Attachment

File Name	File Size
Nappa leather improvements.pdf	0.9273 MB

Vehicle Type

Type	Eng	Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	Chassis range	Struc Week Range
234							2017-2017		0000350-0008728	201617-201640
256							2016-2017		0000561-0140101	201505-201640

CSC Customer Symptom Codes

Code	Description
S1	Seat upholstery/padding/Loose, poor fit, warped, wrinkled or soft/hard
S2	Seat upholstery/padding/Tears, snags, cracks
S4	Seat upholstery/padding/Split seams

VST Operation Number

DTC Diagnostic Trouble Codes

Text



DESCRIPTION:

Improvements have been made to Nappa leather seat cushions to protect against wrinkles and wear.

Improvements apply to Nappa leather, comfort seats:

See vehicle details:

Ventilated: RC00, RC20, UC00, WC00

Non ventilated: RB00, RB20, UB00, WB00

SERVICE:

See attachment "Nappa leather improvements.pdf" for information.

Always replace both together, seat cushion upholstery and seat cushion foam.

Both sides (Driver and/or passenger) should not be replaced as a pair if only one side has an issue.
The backrest does not have to be replaced if only the seat cushion has an issue.

VEHICLE REPORT:

Yes, please submit a Vehicle Report if the service solution described in this TJ has no effect. Use concern area "Vehicle Report" and sub concern area "Support not needed", use function group 8521.

To view TJ attachment continue to next page. This TJ has one attachment.

Nappa leather improvements




Issue:

Early wear on top of bolster seam and cushion.
(Cloth is folded to one side, which gives a higher level.)



Solution:

New seam on bolster.
(Cloth is now folded to both sides. Gives a flat connection.)

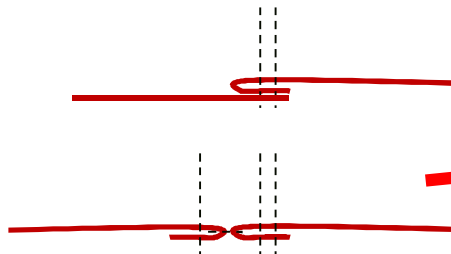


**Issue:**

Early wear on outside of bolster cushion.

**Solution:**

Steel wire embedded in the foam.
Prevents the side bolster to fold during egress. Also reduces wrinkles on the inside of side bolster.

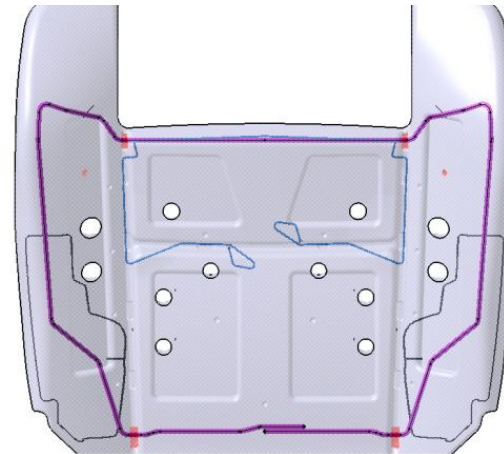





Issue:

Side bolster wrinkles (Clist comes loose and a white piece can be seen.)

Solution:

Elastic material in seam as improvement.
(Tape can be applied on older seats for better grip)

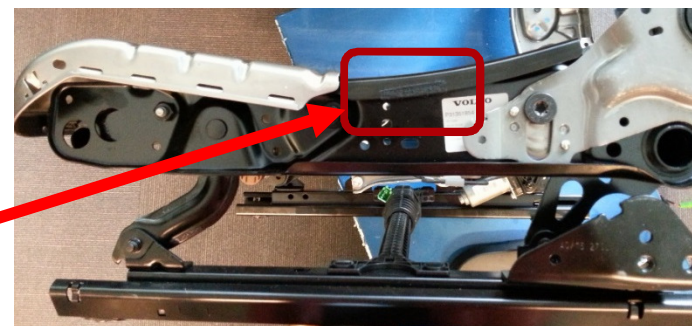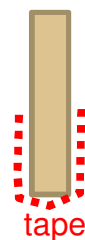

**Issue:**

Side bolster wrinkles

**Solution:**

Elastic material at rear end of the seat. Together with the embedded steel wire and cliplist on elastic material it decrease the risk for wrinkles.

