

8/24/2016 MY13 – 17 ZD

## GPOP - Issue Review System

**Part Number:** 53010704A\$

**Part Description:** Differential

**Issue Description:** On vipers not equipped with the ACR package, during track use with high cornering forces the axle vent on the cover can leak axle fluid. The ACR package includes a different axle with a finned cover that includes an internal baffle to prevent axle fluid from reaching the vent. For vehicles that come in for service due to an axle leak, if the source of the leak is found to be the vent (as evidenced by fluid residue in the area around the vent and on the back of the cover), instead of simply topping off fluid or replacing the axle, drain the fluid, replace the existing axle cover with the ACR cover P/N 68294747AA, and refill with fluid. The drain and fill procedures are according to the existing work instructions.

~

~  
Contact us at [CAGRIS@Chrysler.com](mailto:CAGRIS@Chrysler.com) for feedback related ONLY to this GPOP Tech Tip. Please include the Part Number(s) and Tech Tip Part Description of the Tech Tip you are referencing for our tracking system