



TECHNICAL SERVICE BULLETIN

TSB#: 16-009 Job Code: 9801288 Flat Rate: .4 hr

Date of Publication: March 2016

**NOTE: This Technical Service Bulletin will be valid within (1) year from the original date of publication.
REQUIRES PARTS KIT ORDERED**

ACTION REQUIRED:

Add steel plug to furnace to ensure proper operation.

AFFECTED UNITS

2016 Jay Feather Feather X23B G1JB 0301-0303, 0308,0311-0312, 0314-0316, 0321-0324,0328-0329,
0332, 0344, 0367


PARTS KIT 16-009JT

Note: Parts Kit can only be ordered using the order form for TSB 16-009

- 1 Steel plug
- 1 Screw, #8 x .75 SDS
Furnace tape, silver 3"x 36" piece
(cut into 3 - 12" pieces)

TOOLS

Screwgun w/ #2 Square drive bit

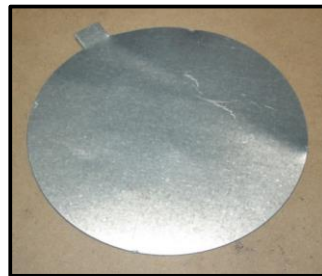

Steel plug

INSTRUCTIONS

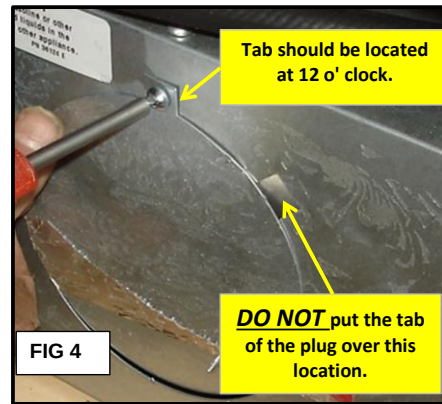


FIG 1



FIG 2

- 1 Fig 1: Wood Vent below the refrigerator - Remove the 4 screws
Fig 2: Gently pull the wood vent out to access the furnace.



2 **Fig 3:** Shows furnace area where the plug was removed.

Fig 4: Attach the steel plug over the hole by installing the #8 screw through the tab of the plug and into the furnace.

IMPORTANT: ATTACH THE PLUG EXACTLY AS SHOWN IN FIG 4. THE TAB SHOULD BE AT THE 12 O' CLOCK POSITION.



3 **Fig 5:** Cover the plug with the 3 pcs of silver furnace tape to seal complete area around the plug.

Fig 6: Completed repair.

Re-install the wood vent under the refrigerator.