

Operational complaints for LED headlamps

Topic number	LI82.10-P-063837
Version	2
Design group	82.10 Exterior lights
Date	08-01-2016
Validity	Model X253
Reason for change	Complaint revised
Reason for block	

Complaint:

Dynamic LED headlamps:

Low beam is lit on one side, also may occur with ignition off and vehicle locked.

The low beam switches off after bus idle.

Fault code:

U118A00 - Communication with the control unit 'Left headlamp range adjustment' has a malfunction

U118B00 - Communication with the control unit 'Right headlamp range adjustment' has a malfunction

Static LED headlamps:

Low beams/ position lights/ daytime running lights inoperative.

Fault code:

U118A00 - Communication with the control unit 'Left headlamp range adjustment' has a malfunction

U118B00 - Communication with the control unit 'Right headlamp range adjustment' has a malfunction

Cause:

Headlamp control unit variance

Remedy:

Replace headlamp control unit.

Symptoms
Overall vehicle / Lighting / Exterior lights / Standing/parking lights / Standing lights / Constantly on (light)

Operation numbers/damage codes

XENTRY TIPS

Op. no.	Operation text	Time	Damage code	Note
			87A0Y 73	
			87N0Y 73	