



SI M64 01 16
Heating and Air Conditioning

March 2016
Technical Service

SUBJECT

Water Ingress In Footwell Area From A/C Condensate Drain

MODEL

F54 (Cooper, Cooper S Clubman)

F55 (Cooper, Cooper S Harddtop 4 door)

F56 (Cooper, Cooper S Harddtop 2 door)

F57 (Cooper, Cooper S Convertible)

SITUATION

Customer complains of musty odor and/or damp front footwell carpet.

CAUSE

The A/C condensate drain hose is either blocked by the heatshield or not attached properly to the the housing.

PROCEDURE

Replace the A/C condensate drain.

Refer to M640116 Attachment for repair procedure.

PARTS INFORMATION

Part Number	Description	Quantity
64 11 9 262 789	Condensate water drain	1
64 11 9 262 790	Retaining ring	If needed

WARRANTY INFORMATION

Covered under the terms of the MINI New Passenger Car Limited Warranty

Defect Code:	64 11 33 32 00	
Labor Operation:	Labor Allowance:	Description:
51 16 227	Refer to KSD2	Removing and installing or replacing side trim cover on center console, left or right
And:		

18 00 518	Refer to KSD2	Remove and install or replace exhaust
And:		
64 99 000	3 FRU	Work time to modify and install condensate drain and retaining ring

If you are using a Main labor code for another repair, use the Plus code labor operation 51 16 727 instead.

Refer to KSD2 for the corresponding flat rate unit (FRU) allowances.

Work time labor operation code 64 99 000 is not considered a Main labor operation. Also, since the “work time” FRU allowance to be claimed is specified, a separate punch time is not required.

ATTACHMENTS

View PDF attachment [M640116 Attachment](#).

[Copyright ©2016 BMW of North America, Inc.]