

8/10/2016 MY15 LA, LD

GPOP - Issue Review System

Part Number: 05154262A\$

Part Description: Hub & Bearing Assy - Front

Issue For LA, LD SRT vehicles with the 2-piece front brake rotor (BR7 sales code), do
Description: NOT replace the front Hub & Bearing Assy for a clicking noise occurring while turning during low speed parking lot maneuvers. Instead, remove front wheels and rotors and clean mating surfaces (wheel mounting face, rotor mounting faces (both sides), and hub face) with a Scotch Brite Pad or equivalent, and re-assemble. ~

~

~

Contact us at CAGRIS@Chrysler.com for feedback related ONLY to this GPOP Tech Tip. Please include the Part Number(s) and Tech Tip Part Description of the Tech Tip you are referencing for our tracking system.
