



# Technical Bulletin

---

Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Golf, Golf GTI	2015 - 2016	All	All	All	All

## Condition

**60 16 02** February 5, 2016 **2043031** Supersedes Technical Bulletin V601602 dated February 1, 2016 to update part number in parts table.

### Rattle or Creaking Noise from Panoramic Sunroof

A rattle or creaking noise may be heard from the rear of the Panoramic Sunroof when driving on uneven roads with the sunroof closed.

## Technical Background

Rattle or creaking noise is caused by the relative movement between the glass panel seal and body when the sunroof is closed.

## Production Solution

Not applicable.



# Technical Bulletin

---

## Service

### Apply self-adhesive protective film to vehicle body:

- Cut the protective film sheet (part number AKL 448 300 04) into 3 strips 12 mm wide x 290 mm (290 mm is the length of the long side of the protective film sheet).
- Move the glass panel to the tilt open position.
- Thoroughly clean the contact area between the rear glass panel seal and the body.
- Apply the self-adhesive protective film strip to the body (Figure 1, in red).
- Close the glass panel.

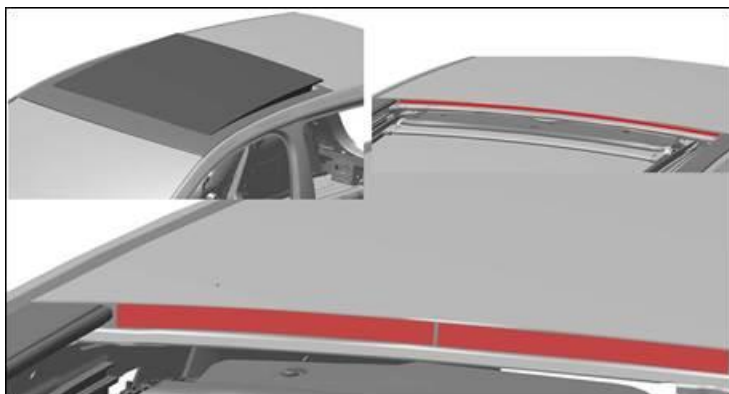


Figure 1) Area to apply the self-adhesive film (glass panel removed for illustration purposes).



# Technical Bulletin

## Warranty

<b>To determine if this procedure is covered under Warranty, always refer to the Warranty Policies and Procedures Manual <sup>1)</sup></b>					
<b>Model(s)</b>	<b>Year(s)</b>	<b>Eng. Code(s)</b>	<b>Trans. Code(s)</b>	<b>VIN Range From</b>	<b>VIN Range To</b>
Golf, Golf GTI	2015 - 2016	All	All	All	All
<b>SAGA Coding</b>					
<b>Claim Type:</b>			<b>Use applicable Claim Type <sup>1)</sup></b>		
<b>Service Number:</b>	<b>Damage Code</b>	<b>HST</b>		<b>Damage Location (Depends on Service No.)</b>	
6042	0020	--		Use applicable when indicated in Elsa (L/R)	
<b>Parts Manufacturer</b>		<b>Golf, Golf GTI</b>		<b>3ME <sup>2)</sup></b>	
<b>Labor Operation <sup>3)</sup> :</b> Install self-adhesive protective film			60422399 = 30 TU		
<b>Causal Part: Select Labor Operation</b>			60422399		
<b>Diagnostic Time <sup>4)</sup></b>					
<b>GFF Time expenditure</b>	01500000 = 00 TU max.		NO		
<b>Road Test</b>	01210002 = 10 TU max. 01210004 = 10 TU max.		YES		
<b>Technical Diagnosis</b>	01320000 = 00 TU max.		NO		
<b>Claim Comment: Input "As per Technical Bulletin 2043031" in comment section of Warranty claim.</b>					
<sup>1)</sup> Vehicle may be outside any Warranty in which case this Technical Bulletin is informational only <sup>2)</sup> Code per warranty vendor code policy. <sup>3)</sup> Labor Time Units (TUs) are subject to change with ELSA updates. <sup>4)</sup> Documentation required per Warranty Policies and Procedures Manual.					



# Technical Bulletin

---

## Required Parts and Tools

Part No:	Part Description	Quantity
AKL 448 300 04	Protective film	1

No Special Tools required.

## Additional Information

All part and service references provided in this Technical Bulletin are subject to change and/or removal. Always check with your Parts Dept. and Repair Manuals for the latest information.