

Service Bulletin

File in Section:

Bulletin No.: 16-NA-004

Date: February, 2016

TECHNICAL

Subject: Intermittent Multiple IPC Warning Lamps Illuminated, Loss of Power Steering Assist,

Service Power Steering Message on DIC, Malfunction Indicator Lamp Illuminated,

Multiple HSLAN U-Codes Set

Attention: This Bulletin also applies to any of the models that may be Export vehicles.

| Brand: | Model: | Model Year: | | VIN: | | Engine: | Transmission: |
|-----------|---------|-------------|------|------|----|------------|---------------|
| Branu. | woder. | from | to | from | to | | |
| Chevrolet | Equinox | 2012 | 2016 | | | 241 (LEA) | |
| GMC | Terrain | | | | | 2.4L (LEA) | |

| Condition | Some customers may comment on the following conditions: Intermittent multiple IPC warning lamps illuminated. Loss of power steering assist. Service Power Steering message. Malfunction Indicator Lamp illuminated. Multiple HSLAN U-Codes set. | |
|-----------|--|--|
| Cause | This may be caused by the engine wiring harness chaffing on the edge of the fuel purcover. | |

Correction



4363219

- 1. Inspect the engine wiring harness conduit and wires for chaffing.
- Repair the wires per the Wiring Repairs procedure in SI.

- 3. Wrap the engine wiring harness with Polyester Electrical/Anti-Abrasive Tape (PET) or equivalent anti-abrasion tape.
- Using a small metal file, remove any burrs and sharp edges along the fuel pump cover edge in the area illustrated above.
- 5. Position the engine wiring harness away from the edge of the fuel pump cover.

Warranty Information

For vehicles repaired under warranty, use:

| Labor Operation | Description | Labor Time |
|--------------------|---------------------|--|
| 5430902 | Wire-to-Wire Repair | Use Published Labor Operation Time |

| Version | 1 |
|----------|---|
| Modified | |