

Service Bulletin

File in Section:

Bulletin No.: 16-NA-013

Date: January, 2016

TECHNICAL


Subject: No Reverse, No Third, DTC P0716, P0717

Attention: This Bulletin also applies to any of the models that may be Export vehicles.

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to	1	
Buick	Enclave, LaCrosse, Regal	2016					
Cadillac	XTS, SRX						
Chevrolet	Equinox, Impala (VIN 1), Impala (VIN W), Traverse					All	MH2, MHM, M7U, M7V, M7W, M7X
GMC	Acadia, Terrain						

Condition	Some customers may comment on a condition of no Reverse. Some may also comment on no 3rd gear. Technicians may find an erratic input speed signal. DTCs P0716 and/or P0717 may be found as active or history DTCs.
Cause This condition may be caused by the Input Shaft Speed Sensor Reluctor Ring Ring being out of the groove.	

Correction

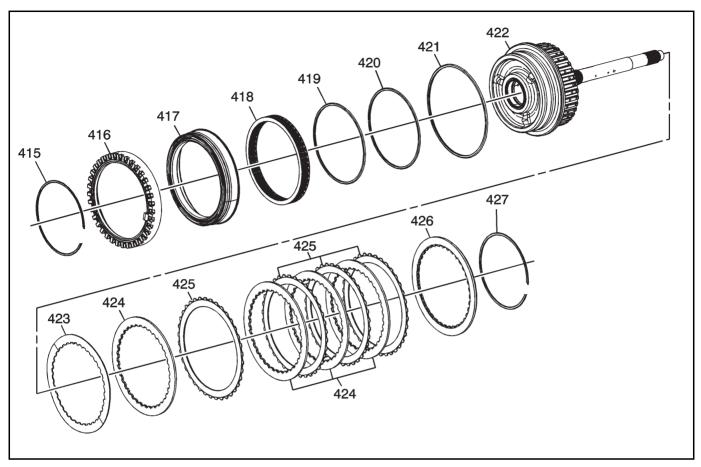

1725896

Replacement of the Retainer Ring (415), Input Shaft Speed Sensor Reluctor Wheel (416), 3-5-Reverse Clutch Piston (417) and 3-5-Reverse and 4-5-6 Clutch Housing Assembly (422). Inspect and replace other distressed parts as needed.

Service Procedure

Refer to 3-5-Reverse and 4-5-6 Clutch Housing Overhaul in SI.

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
8466450	3-5-Reverse Clutch Plate Replacement	Use Published Labor Operation Time

Version	1
Modified	