




Pushout Window Latch Switch Screw Adjustment

UPDATE

Models Affected: All 2015 Model Year and Newer Buses with Pushout Sash Windows.

WARNING: Always follow all Federal, State, Local and Shop safety standards and use proper safety equipment when performing these procedures.

If you are experiencing intermittent buzzer alarms from a push out window, follow the adjustment procedures on the attached page.

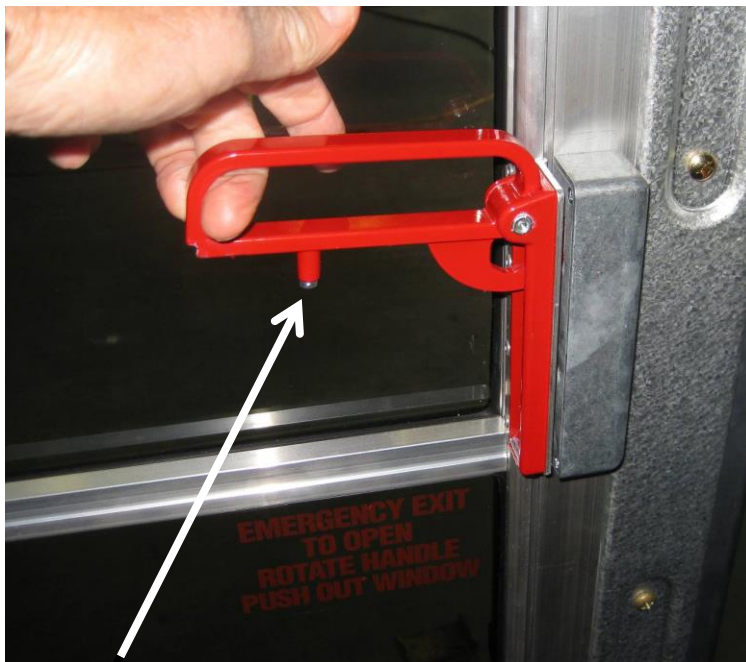

Adjustment is in the handle, see adjustment procedure on attached page



Switch is not adjustable

S U 1 6 0 2



S E R V I C E U P D A T E

ADJUSTMENT PROCEDURES – PUSH OUT LATCH SWITCH SCREW

The Lippert Push-Out Window was designed with an adjustment feature in the latch to overcome any slight variations that may occur during window installation or settling. Every Push-Out window is tested for continuity at the factory prior to shipment.

If the variation is enough to cause the latch not to engage the alarm switch a simple adjustment of the screw can correct the issue.

Lift the Push-Out Latch Handle to reveal the Hex. Head Adjustment Screw.

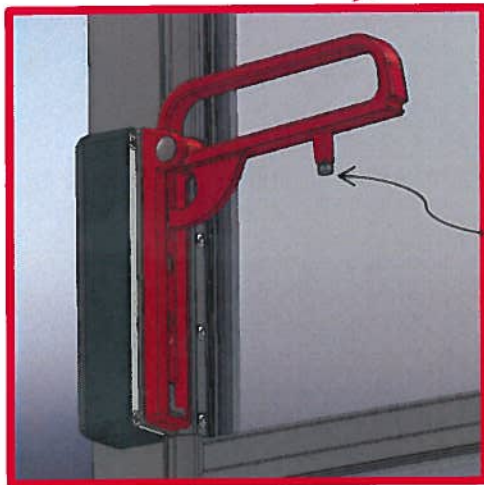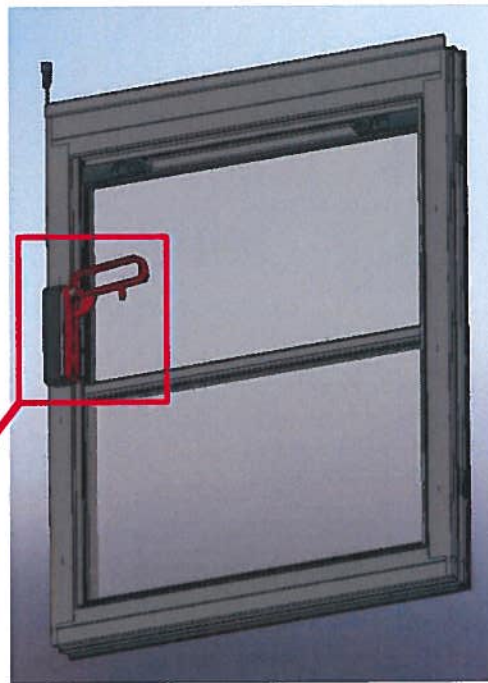

With a wrench turn the screw counter-clockwise to adjust the screw out until it properly engages the alarm switch when the handle is closed. Adjust in one-half turn increments, closing the latch handle to check continuity. Note that the screw has a lock patch to keep it in position after adjustment.