



Service Bulletin

File in Section: -

Bulletin No.: 16-NA-049


Date: April, 2016

TECHNICAL

Subject: Clicking Noise Near Brake Pedal, Hard Brake Pedal, White Tie Strap on Brake Pedal Assembly and/or Possible DTCs C058A, P2299 or P05E0 Set

Attention: This Bulletin also applies to any of the models that may be South Korea Export models.

| Brand: | Model: | Model Year: | | VIN: | | Engine: | Transmission: |
|-----------|--------|-------------|------|------|----|---------|---------------|
| | | from | to | from | to | | |
| Chevrolet | Volt | 2016 | 2017 | | | All | All |

| | |
|------------------|--|
| Condition |  |
| | <p style="font-size: small;">4418521</p> <p>Some customers may comment on a white tie strap around the brake pedal assembly, clicking noise near the brake pedal, hard brake pedal or brake light on. During diagnosis a technician may find DTCs C058A, P2299 or P05E0 set.</p> |
| Cause | The assembly plant may have left a temporary tie strap on the brake pedal assembly during the assembly process. |

Correction

If you encounter a vehicle with the above concern, check to see if the temporary tie strap was left on the brake pedal assembly, if so cut and discard the tie strap.

If there is a code set, be sure the code is not current and refer to SI for further diagnosis.

Warranty Information

| Labor Operation | Description | Labor Time |
|--|--|------------|
| 2480178* | Removing Tie-Strap From Brake Pedal Assembly | 0.3 hr |
| *This is a unique Labor Operation for Bulletin use only. | | |

| | |
|----------|--|
| Version | 2 |
| Modified | April 5, 2016 — Added the 2017 Chevrolet Volt. |

