

Service Bulletin

File in Section:

Bulletin No.: 16-NA-120

Date: April, 2016

TECHNICAL

Subject: Rattle Noise Under Vehicle When Turning Left During Rough Road Conditions

Attention: This Bulletin also applies to any of the models that may be Export vehicles.


Brand: Model:		Model Year:		VIN:		Engine:	Transmission:
Branu.	woder.	from	to	from	to		
Chevrolet	Trax/Tracker	2015	2016	July 7, 2015	July 10, 2015	All	All

Condition	Some customers may comment on a front end rattle noise under the vehicle when turning the steering wheel to the left while driving in rough road conditions.
Cause	This may be caused by a cold weld fracture in the cradle at the left hand side lower control arm attachment.
Additional Options	Vehicles Built in San Luis Potosi, Mexico (RPO SPM)

Correction


If you encounter a vehicle with this condition, complete the following steps:

1. Raise the vehicle. Refer to *Lifting and Jacking the Vehicle* in SI.

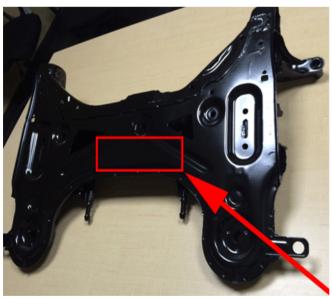

4489155

2. Visually inspect the cradle in the approximate location above for the julian date.

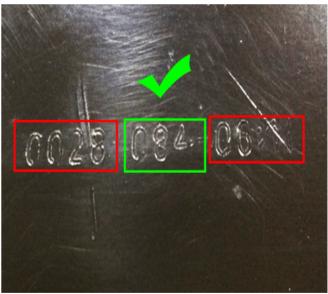

4489156

The julian date will be the middle three numbers as illustrated above.

If the julian date is 189 or 190, continue on to step 3. If the julian date is not 189 or 190, continue diagnosis referring to SI.

Note: If you are unable to read the julian date, proceed to step 3.

3. Replace the cradle. Refer to *Drivetrain and Front Suspension Frame Replacement* in SI.

Parts Information

Description	Part Number	Qty
CRADLE ASM- DRIVETRAIN & FRT SUSP	94780882	1

Warranty Information

Labor Operation	Description	Labor Time
1431640	Drivetrain and Front Suspension Frame Replacement	Use Published Labor Operation Time

Version	1
Modified	