



Service Bulletin

File in Section: -

Bulletin No.: 16-NA-126

Date: April, 2016

TECHNICAL

Subject: Battery Goes Dead Intermittently with no Parasitic Drain Noted

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Buick	Cascade	2016	2016	SOP	GG088621		

Condition	Some customers may comment that the battery goes dead when driven short distances and then sitting for long periods of time.
Cause	If the battery drops below 65% state of charge, tail lamps can send a diagnostic request to the BCM causing everything on the BUS to wake up and remain awake until battery drains.

Correction

Replace the tail lamps with revised lamps. Refer to *Tail Lamp Replacement* in SI. Using the GR8, Charge and Test to top off the battery after replacing the tail lamps.

Parts Information

Description	Part Number	Qty
Lamp, RR Combination L	39077219	1
Lamp, RR Combination R	39077220	1

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
2041490	Tail Lamp Replacement	Use Published Labor Operation Time

Version	1
Modified	

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY
TECHNICIAN
CERTIFICATION