

Reference	SSM67917
Models	XF / X250 XJ / X351 F-TYPE / X152 XK / X150
Title	Vehicle seat memory module logs U1A4C 00, 2010 my onwards
Category	Body
Last modified	06-Sep-2013 00:00:00
Symptom	101000 Seating
Content	<p><u>Issue</u> Incorrectly configured Seat Modules can cause incorrect functioning of the seat, or battery drain issues. The vehicle seat memory module logs U1A4C 00, "build end of line mode active"</p> <p><u>Cause</u> The seat module has been incorrectly configured to the vehicle.</p> <p><u>Action</u> Using SDD, reconfigure the Seat Memory Module as a NEW module. Reconfigure as existing module will not solve this issue. After completing the process, check for correct function of the windows and time settings on the vehicle before handing back to the customer</p>