



Service Bulletin

File in Section: -

Bulletin No.: 16-NA-186

Date: June, 2016

TECHNICAL

Subject: Intermittent Generator Drive Belt Squeal

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission
		from	to	from	to		
Cadillac	CT6 (Plant U: 11th Position of VIN)	2016	2016	SOP	May 6, 2016	All	All
Cadillac	CT6 (Plant A: 11th Position of VIN)	2016	2016	SOP	April 22, 2016	All	All

Involved Region or Country	North America and China
Additional Options (RPO)	Equipped with Twin Turbo 3.0L V6 Engine (RPO LGW)
Condition	Some customers may comment that the generator belt exhibits a squeal at times.
Cause	This condition may be caused by the generator belt being manufactured too long. This can result in a squeal during high (100%) generator duty cycle.

Correction

If you encounter a vehicle with the above concern, replace the generator belt with the newly designed part. Refer to *Fan and Generator Belt Replacement* in SI.

Parts Information

Description	Part Number	Qty
BELT-ACSRV DR AUX	12678130	1

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
4062780	Fan and Generator Belt Replacement	0.4 hr*

*The next update of the Labor Time Guide will contain this new time.

Version	1
Modified	

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.

Copyright 2016 General Motors LLC. All Rights Reserved.



WE SUPPORT VOLUNTARY
TECHNICIAN
CERTIFICATION