

Service Bulletin

File in Section:

Bulletin No.: 16-NA-113

Date: August, 2016

TECHNICAL

Subject: Driver Side Wiper Does Not Clean Windshield Properly


Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
Біапи.	woder.	from	to	from	to		
Buick	Encore	2013	2016	SOD 2012	February		
Chevrolet	Trax	2013	2016	SOP 2013	5, 2016	All	All
Chevrolet	Sonic	2013	2015				

Involved Region or Country	NORTH AMERICA, AUSTRALIA, CHINA, KOREA, BRAZIL, THAILAND		
Condition	Some customers may comment that the driver side wiper streaks and/or leaves marks on the windshield.		
Cause	The original wiper arm and blades have had design changes implemented, which will improve the wiper performance.		

Correction

For those vehicles displaying the condition, replace the wiper arm and blade.

Service Procedure

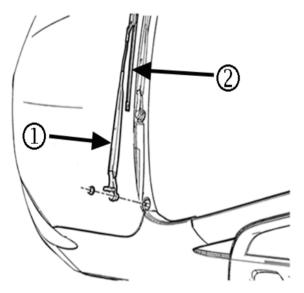

4376071

- Remove the driver side wiper arm (1) and blade (2). Refer to Windshield Wiper Arm Replacement in SI.
- Install the new service part wiper arm (1) and blade
 listed in the part information below. Refer to Windshield Wiper Arm Replacement in SI.

Parts Information

Description	Part Number	Qty
BLADE ASM-WSW (Encore and Trax)	94531969	1
ARM ASM-WSW (Encore and Trax)	42429688	1
BLADE ASM-WSW (Sonic)	42495284	1
ARM ASM-WSW (Sonic)	42495283	1

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
2070280	Windshield Wiper Arm Replacement	Use Published Labor Operation Time

Version	2
Modified	August 18, 2016 – Corrected Model years and added Chevrolet Sonic Model.