

## **Service Bulletin**

File in Section:

Bulletin No.: 16-NA-246

Date: August, 2016

## **INFORMATION**

**Subject: Information on Airbag Warning Lamp Illuminated** 

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Buick	LaCrosse	2017	2017			All	All
Cadillac	CT6	2016	2017				
Cadillac	ATS CTS -A Escalade Models XT5	2017	2017				
Chevrolet	Malibu (VIN Z)	2016	2016				
Chevrolet	Camaro Volt	2016	2017				
Chevrolet	Colorado Impala Silverado Suburban Tahoe Models	2017	2017				
GMC	Acadia (VIN N) Canyon Sierra Yukon Models	2017	2017				

Involved Region or Country	NORTH AMERICA, ISRAEL and N.A. Export Regions
Condition	Some customers may comment that the airbag warning lamp is illuminated.  Upon inspection, the technician may find one, or more, airbag DTC(s) stored, either active or history.

Page 2 August, 2016 Bulletin No.: 16-NA-246



Cause

4561491

The cause of the condition may be an airbag warning lamp connector, which may be loose or not fully seated. An example is shown in the graphic above.

## Correction

Technicians may find one, or more, of the following airbag DTC(s) stored, either active or history: B0012, B0013, B0014, B0015, B0016, B0017, B0018, B0019, B0020, B0021, B0022, B0023, B0024, B001A or B001B.



4561492

**Important:** Any time the airbag connector is disconnected and reconnected, the technician should perform a "push / push" test (NOT A "push /pull") on the connector, to ensure it is fully seated.

When following the diagnostics for the DTC(s), carefully inspect the airbag connector for complete contact. If the airbag connector is not fully seated, disconnect, reconnect, then verify the repair.

Bulletin No.: 16-NA-246 August, 2016 Page 3

Version	1
Modified	