



Service Bulletin

File in Section: -

Bulletin No.: 16-NA-256

Date: August, 2016

INFORMATION

Subject: Information on Malfunction Indicator Lamp Illuminated with DTC P061A

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Malibu (VIN Z)	2016	2017			All	MKE
Chevrolet	Volt	2016	2017			All	MKV

Involved Region or Country	North America and N.A. Export Regions
Condition	<p>Some customers may comment on a malfunction indicator lamp illuminated with a potential loss of regenerative braking. On the next key cycle, regenerative braking will become available.</p> <p>Important: The friction (conventional) brakes will still function and provide all of the braking for the vehicle.</p> <p>During diagnosis a technician may find DTC P061A set.</p>

Correction

Driving pushing on the brake and accelerator pedal at the same time (2 Foot Driving) may result in a malfunction indicator lamp and loss of regenerative braking.

Inform the customer to avoid driving while pushing the brake pedal and accelerator pedal at the same time.

Clear the DTC and inform the customer of the above information.

Version	1
Modified	

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY
TECHNICIAN
CERTIFICATION